

OAKDALE

ALLEN PARISH (ACP)(KACP) 4 S UTC-6(-5DT) N30°45.03' W92°41.31'

HOUSTON

107 B NOTAM FILE DRI

H-7D, L-21B, 22E

RWY 18-36: H5000X75 (ASPH) S-11 MIRL

IAP

RWY 18: REIL. PAPI(P2L)—GA 3.0° TCH 50'. Trees.

RWY 36: REIL. PAPI(P2L)—GA 3.0° TCH 51'. Trees.

SERVICE: FUEL 100LL, JET A LGT MIRL Rwy 18-36; REIL Rwy 18 and

Rwy 36 preset low ints dusk to dawn, to incr ints ACTIVATE—CTAF.

AIRPORT REMARKS: Attended continuously. Fuel avbl self service with credit card. Standing water on rwy at midfield after rain.

AIRPORT MANAGER: 318-215-0090

WEATHER DATA SOURCES: AWOS-3PT 118.275 (318) 215-9728.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ POLK APP/DEP CON 123.7

GCO 135.075 (POLK APCH CTL and Flight Services)

RADIO AIDS TO NAVIGATION: NOTAM FILE AEX.

ALEXANDRIA (H) VORTACW 116.1 AEX Chan 108 N31°15.40'

W92°30.06' 195° 31.8 NM to fld. 80/3E.

VOR unusable:

035°-065° blo 2,000'

066°-094° byd 35 NM blo 3,000'


185°-200° byd 35 NM blo 3,000'

201°-214° byd 35 NM blo 2,000'

215°-260° blo 2,000'

261°-285° byd 35 NM blo 2,000'

357°-034° byd 35 NM blo 3,000'

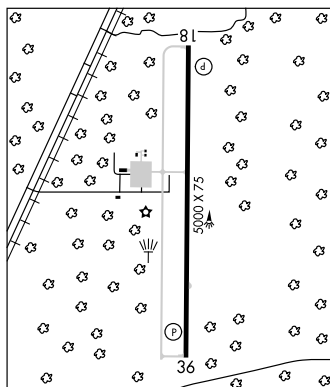

OLLA (L47) 1 E UTC-6(-5DT) N31°53.77' W92°13.07'

HOUSTON

130 B NOTAM FILE DRI

L-22E

RWY 03-21: H3010X75 (ASPH) S-9

RWY 03: Trees.

RWY 21: Thld dsplcd 190'. Road.

SERVICE: LGT Rotating bcn OTS indef.

AIRPORT REMARKS: Unattended. Arpt CLOSED nghts. This airport is open for day VFR operations only. Ponding on rwy and twys during heavy rains.

Rwy 03-21 75' trees along both sides of rwy penetrate transition

slope. Rwy 03 has a dip 450' from apch end of rwy. Rwy 03-21

surface cracked, dip in rwy near Rwy 03 end. 1'-2' grass growing on

rwy. Rwy 03 markings are faded, cracked, and deteriorated. Rwy 21

dsplcd thld markings NSTD, no chevrons, arrows or thld bar. Apron

condition poor.

AIRPORT MANAGER: (318) 312-1106

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE MLU.

MONROE (L) VORTACW 117.2 MLU Chan 119 N32°31.01'

W92°02.16' 191° 38.3 NM to fld. 76/3E. HIWAS.

