

CHURCHVILLE**HARFORD CO** (ØW3) 3 E UTC-5(-4DT) N39°34.01' W76°12.15'

409 B NOTAM FILE DCA

RWY 01-19: 2000X75 (TURF) 0.5% up S**RWY 01:** Pole.**RWY 19:** Thld dsplcd 205'. Trees.**RWY 10-28:** H2000X40 (ASP) LIRL(NSTD) 1.4% up W**RWY 10:** REIL. PAPI(P2L). Trees.**RWY 28:** REIL. PAPI(P2L)—GA 3.0° TCH 19'. Thld dsplcd 100'. Trees.**SERVICE:** S4 FUEL 100LL, JET A LGT ACTIVATE REILS Rwy 10 and Rwy 28; LIRL Rwy 10-28—CTAF. Arpt bcn opr dusk-0600Z±.**AIRPORT REMARKS:** Attended 1300Z±-dusk. Rwy 01-19 CLOSED Nov 15-Apr 30 exc PPR call 410-836-2828. CAUTION: parachute jumping. Extensive glider ops on turf ldg area. Birds/wildlife on and invof arpt. Rwy 01-19 ends/sides marked with barrels. Rwy 10-28 LIRL NSTD, no dsplcd thld lgts.**AIRPORT MANAGER:** 410-836-2828**COMMUNICATIONS:** CTAF/UNICOM 122.8**POTOMAC APP/DEP CON** 125.525**CLEARANCE DELIVERY PHONE:** For CD ctc Potomac Apch at 866-429-5882.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MIV.**DUPONT (L) VORTAC** 114.0 DQO Chan 87 N39°40.69'

W75°36.43' 267° 28.4 NM to fld. 70/10W.

TACAN AZIMUTH & DME unusable:

040°-100° byd 25 NM blo 5,000'

210°-235° byd 30 NM blo 3,000'

235°-265° byd 22 NM

265°-275° byd 30 NM blo 5,000'

310°-320° byd 35 NM blo 4,000'

VOR unusable:

025°-039° byd 25 NM

025°-039° byd 5 NM blo 10,000'

040°-120° byd 25 NM blo 4,000'

125°-225° blo 10,000'

225°-230° byd 15 NM blo 3,000'

230°-265° byd 22 NM

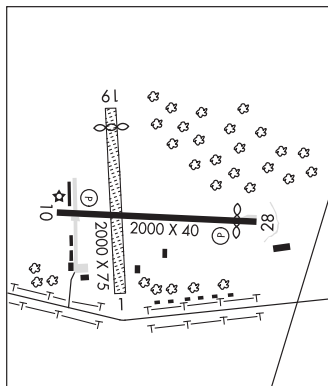
265°-275° byd 30 NM blo 8,000'

300°-315° byd 35 NM blo 3,000'

355°-005° blo 3,000'

355°-005° byd 15 NM blo 4,000'

355°-005° byd 25 NM

WASHINGTON
L-29E, 34F, 36J, A
IAP**CLAREMONT** (See ELKTON on page 97)**CLEARVIEW AIRPARK** (See WESTMINSTER on page 115)