

**UNALAKLEET** (UNK)(PAUN) 1 N UTC-9(-8DT) N63°53.31' W160°47.95'

27 B NOTAM FILE UNK

**RWY 15-33:** H5900X150 (ASPH-GRVD) HIRL

**RWY 15:** VASI(V4L)—GA 3.0° TCH 39'. Rgt tfc.

**RWY 33:** REIL. VASI(V4L)—GA 3.0° TCH 48'.

**RWY 09-27:** H1900X75 (ASPH-GRVD) PCN 59 F/B/X/T MIRL

**SERVICE:** FUEL 100LL, JET A LGT ACTIVATE REIL Rwy 33, HIRL Rwy 15-33, MIRL Rwy 09-27—CTAF. VASI Rwy 15 and Rwy 33 opr 24 hrs.

**AIRPORT REMARKS:** Attended Mon-Fri 1700-0100Z. Fuel avbl 1800-0200Z, after hrs call 624-3330. Unlighted twr, 100' AGL, 0.4 NM north of AER 15. 299' twr 2.4 NM east. No snow removal or deicing 0100-1700Z. Cold temperature restricted airport. Altitude correction required at or below -39C. Rwy condition not monitored, recommend visual inspection prior to lgt. Airframe and power plant repairs avbl on an emerg basis only. Transient parking located near AK DOT maintenance bldg near thld of Rwy 27.

**AIRPORT MANAGER:** (907) 625-1025

**WEATHER DATA SOURCES:** AWOS-3P 132.25 (907) 624-3051. (WX CAM)

**COMMUNICATIONS:** CTAF 123.0

**UNALAKLEET RCO** 122.3(NOME RADIO)

**ANCHORAGE CENTER APP/DEP CON** 135.7 335.5

**AIRSPACE:** CLASS E svc 1500-0400Z; other times CLASS G.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE UNK.

(H) **VOR/DME** 116.9 UNK Chan 116 N63°53.52' W160°41.06' 251° 3.1 NM to fld. 436/15E.

**NORTH RIVER NDB (HW)** 382 JNR N63°54.46' W160°48.71' 153° 1.2 NM to fld. 14/11E.


**LOC/DME** 111.3 I-UNK Chan 50 Rwy 15.

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Nome FSS dial 1-800-478-8400. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

**MC GRATH**

H-1A, H-2I, L-3C

IAP

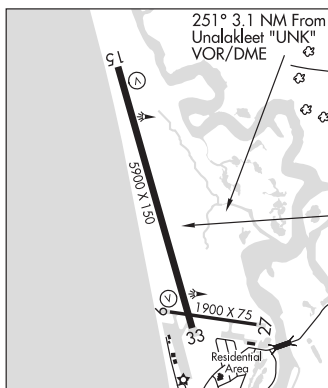

**UNALASKA** (DUT)(PADU) 1 N UTC-9(-8DT) N53°53.94' W166°32.70'

23 B TPA—2101(2078) ARFF Index—See Remarks NOTAM FILE DUT

**RWY 13-31:** H4500X100 (ASPH-GRVD) S-60, 2D-210

PCN 86 F/B/X/T MIRL

**RWY 13:** REIL. VASI(V4L)—GA 3.0° TCH 38'. Thld dsplcd 300'. Boat.

**RWY 31:** REIL. VASI(V4R)—GA 3.0° TCH 32'. Thld dsplcd 300'. Boat. Rgt tfc.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 13:** TORA-4500 TODA-4500 ASDA-4200 LDA-3900

**RWY 31:** TORA-4337 TODA-4500 ASDA-4200 LDA-3900

**SERVICE:** FUEL JET A LGT For MIRL Rwy 13-31, REIL Rwy 13 and 31; stop lgt for vehicle tfc crossing Rwy 31 thld; key 122.6 - 7 times for on, 3 times for stop lgt and REIL off. VASI Rwy 13 and Rwy 31 opr continuously. VASI Rwy 31 usable distance is 1.4 miles due to mountain. VASI right side of rwy skewed 5° south of rwy heading.

**AIRPORT REMARKS:** Attended 1700-0130Z. Class I, ARFF Index A.

CLOSED to air carrier ops with more than 30 pax seats exc PPR in writing to arpt mgr P.O. Box 920525, Dutch Harbor, AK 99692. ARFF eqpt staffed only during periods of large air carrier ops. Arpt maint duty hrs 1700-0130Z Mon thru Sun. Arpt hazard reporting only performed during maintenance duty hrs and for air carrier ops over 30 pax seat acft. Snow removal and deicing of rwy, twy, and ramps only performed during maintenance duty hrs. Tfc pattern around mountain. Tran acft must park on Ramp B. Be alert: vessel tfc within 1,500' from Rwy 13. Be Alert: Vessel fueling dock within 1,300' from Rwy 31. Arpt area subject to moderate to extreme concentrations of birds. Do not perform locked wheel turns on Rwy 13-31. Personnel and eqpt may be working on the rwy at any time. Jet blast area AER 31 clsd to taxiing acft exc when road vehicle and pedestrian tfc is ctld by ops representative. Clockwise turn requested. For seaplane gate opr key 122.8, 7 times to open, 3 times to close, gate closes automatically after 5 minutes. See Section "C" notices for gate ctl procedure.

**AIRPORT MANAGER:** 907-581-1786

**WEATHER DATA SOURCES:** AWOS-3P 125.8 (907) 581-2803. (WX CAM)

**COMMUNICATIONS:** CTAF 122.6

**RCO** 122.6 (COLD BAY RADIO)

**ANCHORAGE CENTER APP/DEP CON** 121.4

**DUTCH HARBOR**

H-2I, L-2J

IAP



CONTINUED ON NEXT PAGE

AK, 25 FEB 2021 to 22 APR 2021

## CONTINUED FROM PRECEDING PAGE

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DUT.

**DUTCH HARBOR NDB/DME (HW)** 283 DUT Chan 86 N53°54.31' W166°32.87' at fld. 272/9E.

DME portion unusable:

005°-080°

081°-330° byd 13 NM

331°-004° byd 15 NM

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Cold Bay FSS dial 1-800-478-7250. For a toll free call to Kenai FSS dial 1-866-864-1737. Wx information avbl on 129.5 (call sign Dutch WX) or phone 907-581-1256, 1645-0345Z. Cold Bay FSS ops 1700-0300Z, all otr times Kenai FSS.

**UPPER WASILLA LAKE SPB** (See WASILLA on page 271)

**UTOPIA CREEK** N65°59.71' W153°41.63' NOTAM FILE PAIM.

FAIRBANKS

**NDB/DME (HW)** 272 UTO Chan 22(Y) 264° 14.2 NM to Hughes. 983/17E.

L-4I

NDB unusable:

210°-240°

340°-355°

NDB/DME unusable:

45-105 byd 25 NM

105-45

**VALDEZ**

**ROBE LAKE SPB** (L93) 6 W UTC-9(-8DT) N61°05.23' W146°08.64'

ANCHORAGE

39 NOTAM FILE JNU

**WATERWAY E-W:** 4000X200 (WATER)

**WATERWAY N-S:** 2000X200 (WATER)

**SERVICE:** FUEL JET A

**SEAPLANE REMARKS:** Unattended. No dock facilities, seaplane beaching area is used by recreational boaters and swimmers.

Use extreme caution when operating at the seaplane base. Steel bars protruding from the shoreline and water near the shore line.

**AIRPORT MANAGER:** 907-831-1386

**COMMUNICATIONS:** CTAF 122.9

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Juneau FSS dial 1-866-297-2236.

**THOMPSON PASS** (K55) 17 E UTC-9(-8DT) N61°10.64' W145°41.31'

ANCHORAGE

2080 NOTAM FILE JNU

**RWY 05-23:** 2530X9 (TURF-GRVL)

**RWY 05:** Brush.

**RWY 23:** Brush.

**AIRPORT REMARKS:** Unattended. Rwy condition not monitored, recommend visual inspection prior to using. Runway is currently littered with bonfire debris including partially burned wood pallets, broken glass bottles, screws, nails, rusty cans and rock piles. Runway is currently unsafe to operate on. P-line East 1/2 mile in apch path. Hills in apch both rwys at about 1 mi. Unctd vehicular tfc on rwy. Rwy 05-23 rwy sfc is soft after rain, loose grvl and small brush to 6" West half of rwy. East half of rwy overgrown with brush to 4'. Rwy rises slightly at each end. Rwy 05 first 300' soft and rutted. First 1200' has grass and brush to 1' and remainder brush to 4'. 9' usable width along east side of rwy, remainder overgrown with brush to 4'. East half of rwy overgrown with brush to 4', strip 10' by 2270' East side unusable. Rwy sfc is soft after rain, loose gravel and small brush to 6" West half of rwy. East half of rwy overgrown with brush to 4'. Usually turbulent wind. Rwy 05-23 cones and thid panels destroyed and/or covered in brush. Rwy suitable only for conventional gear, high wing acft.

**AIRPORT MANAGER:** (907) 269-8508

**COMMUNICATIONS:** CTAF 122.9

RCO 122.55 (JUNEAU RADIO)

**RADIO AIDS TO NAVIGATION:** NOTAM FILE VDZ.

**MINERAL CREEK NDB (MHW)** 524 MNL N61°07.45' W146°21.13' 061° 19.6 NM to fld. 16/19E.

NDB unusable:

320°-010° byd 15 NM

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Juneau FSS dial 1-866-297-2236.

