

BERLIN

CAMDEN CO (19N) 1 SW UTC-5(-4DT) N39°46.71' W74°56.87'

150 B NOTAM FILE MIV

RWY 05-23: H3094X45 (ASPH) MIRL 0.3% up SW

RWY 05: REIL. PVASI(P5IR)—GA 4.0° TCH 23'. Thld dsplcd 740'.
Trees.

RWY 23: REIL. PVASI(P5IR)—GA 4.0° TCH 40'. Thld dsplcd 239'.
Trees.

SERVICE: S4 **FUEL** 100LL, JET A **LGT** Rwy 05 VGSI OTS indef. Rwy 23 VGSI OTS indef. **ACTIVATE** REIL Rwy 05 and Rwy 23; MIRL Rwy 05-23—CTAF. **ACTIVATE** rotating bcn—CTAF.

AIRPORT REMARKS: Attended 1300-2200Z \ddagger . Unattended Christmas and New Years Day. Deer and geese on and in/ov arpt. Trees along NW side of Rwy 05-23. NSTD twy light spacing. Rwy 05-23 rwy hold line very faded.

AIRPORT MANAGER: 856-767-1233

COMMUNICATIONS: CTAF/UNICOM 123.0

Ⓜ **MC GUIRE APP/DEP CON** 126.475

CLEARANCE DELIVERY PHONE: For CD ctc Mc Guire Apch at 609-754-2767.


RADIO AIDS TO NAVIGATION: NOTAM FILE MIV.

CEDAR LAKE (L) VORW/DME 115.2 VCN Chan 99 N39°32.26'
W74°58.03' 014° 14.5 NM to fld. 120/10W.

WASHINGTON

L-34G, A

IAP

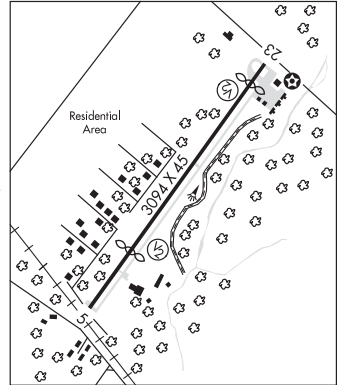

BLAIRSTOWN (1N7) 2 SW UTC-5(-4DT) N40°58.27' W74°59.85'

372 B NOTAM FILE MIV

RWY 07-25: H3112X70 (ASPH) MIRL

RWY 07: Thld dsplcd 318'. Trees.

RWY 25: Thld dsplcd 235'. Trees.

SERVICE: S4 **FUEL** 100LL **OX 2** **LGT** Actvt MIRL Rwy 07-25 CTAF.

AIRPORT REMARKS: Attended 1200-2300Z \ddagger . Gliders and tow airplanes opr from turf area just south of Rwy 07-25. 24 hr self svc fuel. Hill east of arpt may require pilots execute steep apch to Rwy 25. Nmrs transverse and parallel cracks alg entr length of rwy. Rwy 7 and 25 markings barely vsb.

AIRPORT MANAGER: 908-362-8965

COMMUNICATIONS: CTAF/UNICOM 123.0

Ⓜ **NEW YORK APP/DEP CON** 127.6 (from EAST)

Ⓜ **ALLENTOWN APP/DEP CON** 124.45 (from WEST)

CLEARANCE DELIVERY PHONE: For CD ctc Allentown Apch at 800-728-6322.

RADIO AIDS TO NAVIGATION: NOTAM FILE MIV.

STILLWATER (L) VORW/DME 109.6 STW Chan 33 N40°59.75'
W74°52.14' 267° 6.0 NM to fld. 920/11W.

DME unusable:


089°-099° within 12 NM blo 10,000'

210°-320° byd 30 NM blo 4,000'

NEW YORK

L-33A, 34H

IAP

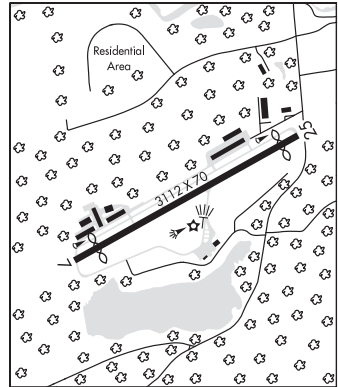

BRIDGETON

BUCKS (00N) 3 NE UTC-5(-4DT) N39°28.38' W75°11.07'

108 NOTAM FILE MIV

RWY 18-36: 1900X150 (TURF) LIRL(NSTD) 0.5% up N

RWY 18: Tree.

RWY 36: Tree.

SERVICE: **LGT** LIRL Rwy 18-36 call 609-649-3752. Arpt lgts call arpt mgr. NSTD lgt config.

AIRPORT REMARKS: Unattended. Arpt clsd to all tran acct Jan 1-Apr 1 because of soft rwy conditions, for PPR call

856-466-3596. Deer and birds on and in/ov arpt. Rwy 36 +55 to +65 ft trees, 500 ft short of thld, 40-75 ft R. +46 ft mkd pline, 330 ft short of thld.

AIRPORT MANAGER: (856) 649-3752

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

WASHINGTON