

## SUTTON

**BRAXTON CO** (481) 3 E UTC-5(-4DT) N38°41.23' W80°39.13'  
1276 B NOTAM FILE EKN

CINCINNATI  
L-29C  
IAP

**RWY 02-20:** H3995X60 (ASPH-AFSC) S-12 MIRL 0.6% up N

**RWY 02:** REIL. Thld dspcd 801'. Trees.

**RWY 20:** REIL. PAPI(P2L)—GA 4.0° TCH 40'. Trees.

**SERVICE:** FUEL 100LL, JET A LGT Dusk-Dawn. After 0400Z‡,  
ACTIVATE REIL Rwy 02 and Rwy 20; PAPI Rwy 20; and MIRL Rwy  
02-20—CTAF. PAPI Rwy 20 unusable byd 6° left and byd 6° right of  
centerline.

**AIRPORT REMARKS:** Unattended. 15' brush, 100' R/L of rwy centerline. Bcn  
located 1/4 mile NW of arpt. 6' ditch crosses AER 02 0-116' from  
thld. Gate access 1200-0000Z‡ 1-2-3-4. 0000Z‡-1200Z‡  
0-7-6-5.

**AIRPORT MANAGER:** (304) 542-3311

**WEATHER DATA SOURCES:** AWOS-3P 118.225 (304) 765-7805.

**COMMUNICATIONS:** CTAF 122.9

® **CLARKSBURG APP/DEP CON** 121.15 (1200-0400Z‡)

**INDIANAPOLIS CENTER APP/DEP CON** 125.55 (0400-1200Z‡)

**CLEARANCE DELIVERY PHONE:** For CD ctc Indianapolis ARTCC at  
317-247-2411.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE EKN.


**ELKINS (L) VORTACW** 114.2 EKN Chan 89 N38°54.87'

W80°05.96' 249° 29.3 NM to fld. 2160/7W.

TACAN AZIMUTH & DME unusable:

081°-189° byd 32 NM blo 9,000'

273°-039° byd 12 NM blo 6,000'

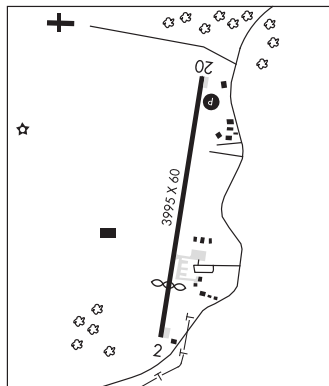

**TITUS FLD** (See ARTHURDALE on page 384)

**TRI-STATE/MILTON J FERGUSON FLD** (See HUNTINGTON on page 391)

**UPSHUR CO RGNL** (See BUCKHANNON on page 386)

**VERSI** N39°15.24' W81°29.10' NOTAM FILE PKB.

CINCINNATI

**NDB (LOMW)** 388 PK 028° 5.9 NM to Mid-Ohio Valley Rgnl. 812/7W.

NDB unusable:

000°-094° byd 10 NM blo 3,000'

095°-149°

150°-210° byd 10 NM

**WADE F MALEY FLD** (See SHINNSTON on page 399)

**WELCH MUNI** (I25) 3 SE UTC-5(-4DT) N37°25.11' W81°31.86'

CINCINNATI

2118 NOTAM FILE EKN

**RWY 09-27:** H2695X50 (ASPH)

**RWY 09:** Trees.

**RWY 27:** Trees.

**AIRPORT REMARKS:** Unattended. Arpt closed indef, except for rotary wing acft. Not suitable for fixed wing acft. Arpt gates locked,  
no public access. No line of sight between rwy ends. Rwy 09-27 pavement condition failed. Sfc rough and cracking. Exstv  
vegetation and trees growing through cracks. Loose stones, rocks and debris on rwy. Tree limbs overhang rwy edges. First  
300' Rwy 27-3 degree bend. Taxi transition to apron Rwy 09-27 unmarked.

**AIRPORT MANAGER:** 304-436-2214

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Indianapolis ARTCC at 317-247-2411.