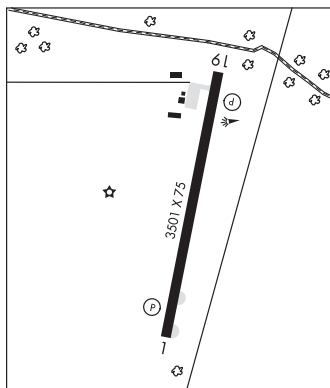


COLUMBIA**CALDWELL PARISH** (F86) 2 NE UTC-6(-5DT) N32°07.33' W92°03.27'**MEMPHIS**
L-18F

67 B NOTAM FILE DRI

RWY 01-19: H3501X75 (ASPH) S-6 MIRL**RWY 01:** REIL. PAPI(P2L)—GA 3.5° TCH 63'. Trees.**RWY 19:** REIL. PAPI(P2L)—GA 3.0° TCH 53'.**SERVICE:** LGT ACTIVATE MIRL Rwy 01-19—CTAF. REIL Rwy 01-19 opr continuously. Rwy 01 REIL OTS approach end Rwy 01. Rwy 19 REIL OTS approach end Rwy 19.**AIRPORT REMARKS:** Unattended. Birds invof arpt. Foreign objects and debris present on apron. Grass growing through cracks. Windssock OTS tempoly.**AIRPORT MANAGER:** (318) 331-3888**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Monroe Apch at 318-327-5641, if unavbl, ctc Fort Worth ARTCC at 817-858-7584.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MLU.**MONROE (L) VORTACW** 117.2 MLU Chan 119 N32°31.01'
W92°02.16' 179° 23.7 NM to fld. 76/3E.**CONCORDIA PARISH** (See VIDALIA on page 120)**COUSHATTA****THE RED RIVER** (ØR7) 2 SE UTC-6(-5DT) N31°59.42' W93°18.46'**HOUSTON**
H-6I, L-22E
IAP

177 B NOTAM FILE DRI

RWY 18-36: H5002X74 (ASPH) S-44 MIRL**RWY 18:** REIL. PAPI(P2L)—GA 3.0° TCH 50'. Trees.**RWY 36:** REIL. PAPI(P2L)—GA 3.0° TCH 50'. Trees.**SERVICE:** LGT MIRL Rwy 18-36, REIL Rwy 18 and 36 preset low intst dusk-dawn, to incr intst actvt—CTAF. Rwy 18 and 36 REILS out of service. Rwy 18 and 36 PAPI out of service. Airport beacon out of service.**AIRPORT REMARKS:** Unattended. 66' trees 253' east of rwy centerline full length. NOTE: See Special Notices—Aerobatic Practice Area.**AIRPORT MANAGER:** 318-932-5710**COMMUNICATIONS:** CTAF 122.9

® POLK APP/DEP CON 132.05

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.**RADIO AIDS TO NAVIGATION:** NOTAM FILE SHV.**BELCHER (H) VORTACW** 117.4 EIC Chan 121 N32°46.28'
W93°48.60' 144° 53.3 NM to fld. 190/7E.