


WAAS CH 42938 W18A	APP CRS 179°	Rwy Idg 5000 TDZE 55 Apt Elev 55
--	------------------------	---

RNAV (GPS) Y RWY 18
PICAYUNE MUNI (MJD)

RNP APCH. Baro-VNAV and VDP NA when using Stennis Intl altimeter setting. Rwy 18 helicopter visibility reduction below 3/4 SM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 5°C. When local altimeter setting not received, use Stennis Intl altimeter setting: increase LPV DA to 377 and visibility all Cats 1/8 mile; increase LNAV/VNAV DA to 621 and visibility all Cats 1/8 mile; increase all MDA 40 feet. Procedure NA when R-4403 B/C/E is active.	MISSED APPROACH: (Do not exceed 185K) Climb to 560 then climbing right turn to 1800 direct CIQYI and hold.
---	--

AWOS-3PT 119.075	GULFPORT APP CON * 124.6 354.1	UNICOM 122.8 (CTAF) 0
----------------------------	--	---------------------------------

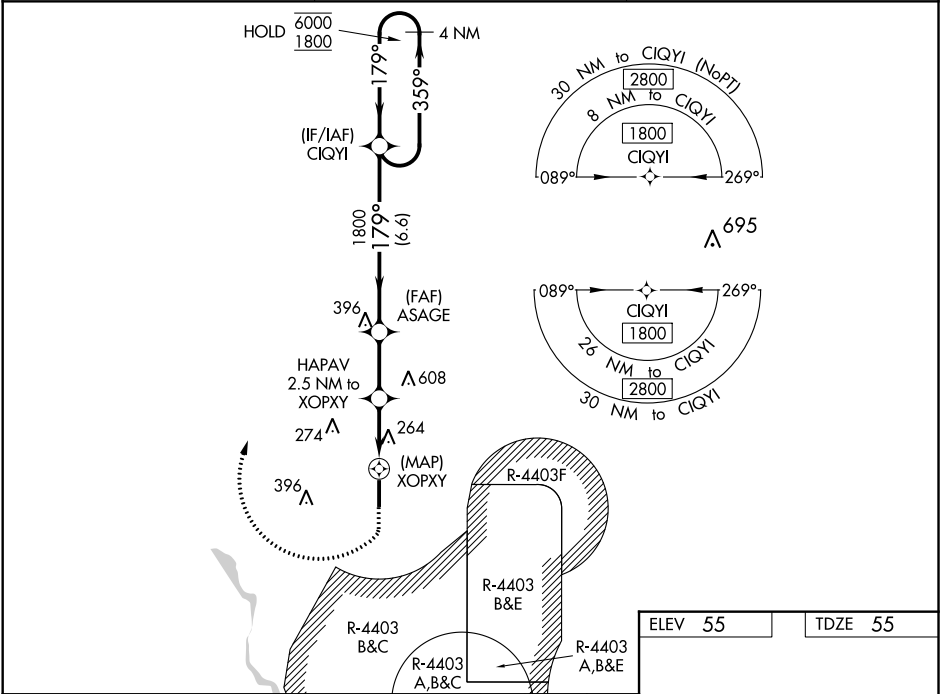

4 NM Holding Pattern		CIQYI	ASAGE	HAPAV	1800	560	1800	CIQYI
GP 3.00° TCH 36		6000	1800	1800	1040	*LNAV only.		
6.6 NM		2.4 NM		1.2 NM	1.3 NM	0.5		
CATEGORY	A	B	C	D				
LPV DA	343-1		288 (300-1)					
LNAV/VNAV DA	587-1 7/8		532 (600-1 7/8)					
LNAV MDA	520-1	465 (500-1)	520-1 3/8 465 (500-1 3/8)					
CIRCLING	520-1 465 (500-1)	580-1 525 (600-1)	NA					
MIRL Rwy 18-36 0								