

LOC/DME I-CMH <u>111.75</u> Chan 54 (Y)	APP CRS 281°	Rwy Idg 10113 TDZE 815 Apt Elev 815
---	------------------------	--

ILS RWY 28L (SA CAT I & II)
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.

T Simultaneous approach authorized.
SA CAT I, SA CAT II: Requires specific OPSPEC, MSPEC, or LOA approval.


MALS




MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
-----------------	------------------------------------	-------------------------------	------------------------	-------------------	-------


ALTERNATE MISSED
APCH FIX

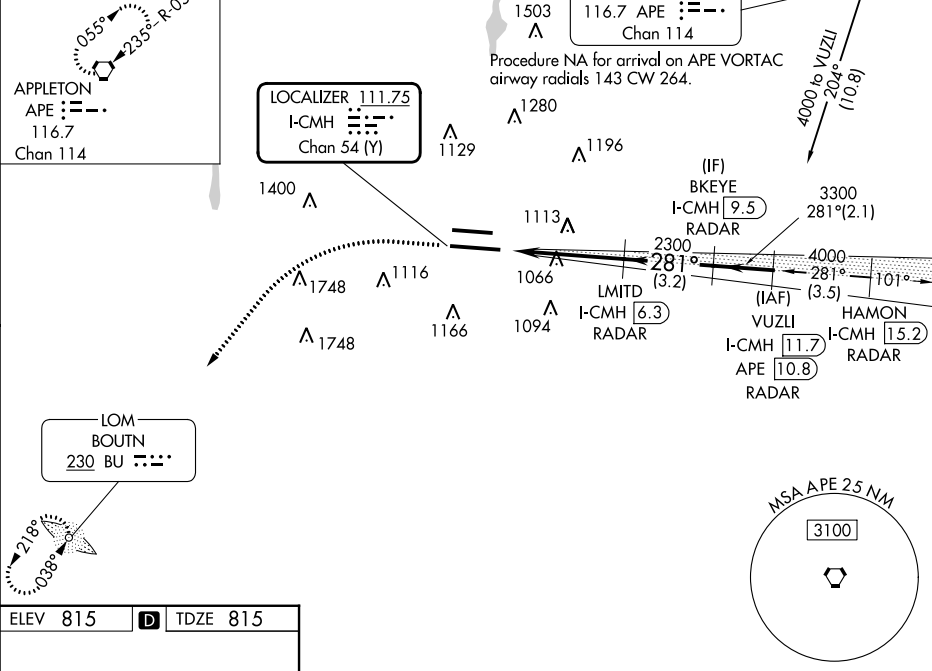

ELEV 815	D	TDZE 815
----------	----------	----------

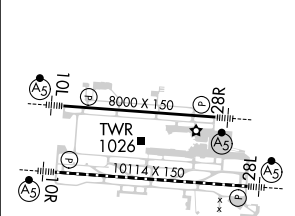

1400	3000	BU	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 68).
------	------	----	---

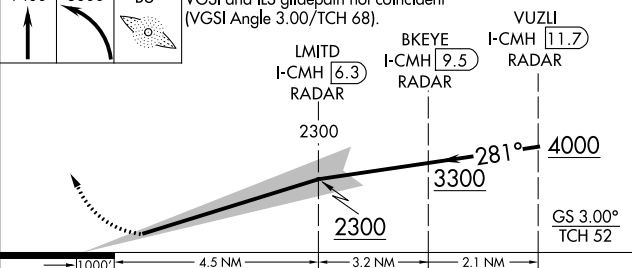

CATEGORY	A	B	C	D
S-ILS 28L	SA CAT I	RA 157/14	150 DA	965
S-ILS 28L	SA CAT II	RA 100/12	100 DA	915

SA CATEGORY I & II ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

COLUMBUS, OHIO
Amdt 31 22APR21

JOHN GLENN COLUMBUS INTL (CMH)
40°00'N-82°54'W **ILS RWY 28L** (SA CAT I & II)

EC-2, 21 MAR 2024 to 18 APR 2024