

**INDEPENDENCE** (207) 1 N UTC-8(-7DT) N36°48.98' W118°12.30'  
 3908 TPA-4708(800) NOTAM FILE RAL  
**RWY 14-32:** H3533X60 (ASPH) S-20 MIRL  
**RWY 14:** Fence.  
**RWY 32:** Trees. Rgt tfc.  
**RWY 05-23:** 1498X30 (DIRT) 1.9% up SW  
**RWY 05:** Road.  
**RWY 23:** Fence.

**SAN FRANCISCO**  
 L-9A

**SERVICE:** LGT ACTIVATE MIRL Rwy 14-32-CTAF.  
**AIRPORT REMARKS:** Unattended. Rwy 05-23 clsd for public use. Rwy 05-23 unsafe for acft. Rwy 05-23 rstd can be used only during extreme crosswind conditions. Tfc pat indicators for Rwy 14-32 only. Rwy 14-32 extsv cracks on the north end of the rwy. Rwy 05-23 marked with an R on each end, no numbers or centerline markings. Rwy 05-23 undulating uneven dirt sfc. Brush in sporadic locations on rwy. Rwy 05-23 sfc uneven, rough, undulating with extsv brush. Unsafe for acft use.

**AIRPORT MANAGER:** 760-872-2971

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Joshua Apch at 661-277-3843.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE BIH.

**BISHOP (L) VOR/DME** 113.35 BIH Chan 80(Y) N37°22.62' W118°21.99' 152° 34.5 NM to fld. 4117/15E.

VOR unusable:

165°-285° byd 12 NM

305°-315° byd 35 NM

340°-135° byd 12 NM

DME unusable:

165°-285° byd 12 NM

305°-315° byd 35 NM

340°-135° byd 12 NM

**INYOKERN** (IYK)(KIYK) 1 NW UTC-8(-7DT) N35°39.52' W117°49.77'

**LOS ANGELES**

2457 B NOTAM FILE IYK

H-41, L-7C

**RWY 15-33:** H7100X75 (ASPH) S-24 PCN 7 F/C/Y/U MIRL

IAP

0.4% up NW

**RWY 15:** PAPI(P2L)-GA 3.0° TCH 40'.

**RWY 33:** PAPI(P2L)-GA 3.3° TCH 40'.

**RWY 02-20:** H6275X75 (ASPH) S-30, D-50, 2D-80 PCN 6 F/C/X/U

MIRL 0.4% up S

**RWY 02:** PAPI(P2L)-GA 3.3° TCH 40'.

**RWY 20:** VASI(V4L)-GA 3.0° TCH 35'. Thld dspcd 320'. Rgt tfc.

**RWY 10-28:** H4150X75 (ASPH) S-24 PCN 7 F/C/Y/U MIRL

1.0% up W

**RWY 28:** Thld dspcd 103'.

**SERVICE:** S2 FUEL 100LL, JET A LGT ACTVT VASI Rwy 20; MIRL Rwy 02-20, Rwy 10-28, Rwy 15-33-CTAF. PAPI Rwy 02, Rwy 15 and Rwy 33 opr consly.

**AIRPORT REMARKS:** Attended Mon-Fri 1500-0100Z±, Frequent glider ops on weekends. After 0000Z± callout fee for svc call 760-382-3383. Rwy 10-28 condition poor but stable. Ptns of rwy ctrln marking obscd by crack filler. Rwy 15-33 surface: pavement experiencing longl and lateral block cracking on ptns of rwy.

**AIRPORT MANAGER:** 760-377-5844

**COMMUNICATIONS:** CTAF/AUNICOM 122.8

JOSHUA APP/DEP CON 133.65

**CLEARANCE DELIVERY PHONE:** For CD ctc Los Angeles ARTCC at 661-575-2079.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE EDW.

**EDWARDS (T) (T) VORTACW** 116.4 EDW Chan 111 N34°58.94' W117°43.96' 341° 40.8 NM to fld. 2378/12E.

TACAN AZIMUTH unusable:

098°-158° byd 19 NM blo 7,900'


DME unusable:

107°-158° byd 19 NM

VOR unusable:

098°-158° byd 19 NM blo 7,900'

**COMM/NAV/WEATHER REMARKS:** Automated UNICOM-3 clicks for arpt advisory and wx or dial 617-262-3825, 4 clicks for radio check. Monitor 122.8 in tfc pat.

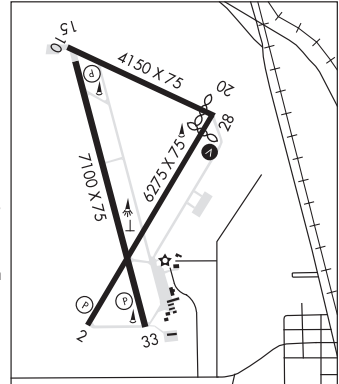

**JACK MC NAMARA FLD** (See CRESCENT CITY on page 139)

**JACK NORTHROP FLD/HAWTHORNE MUNI** (See HAWTHORNE on page 166)