


CHENEGA BAY (C05)(PFCB) 1 NE UTC-9(-8DT) N60°04.71' W147°59.68'
 69 B NOTAM FILE JNU
RWY 16-34: 3000X75 (GRVL) MIRL
RWY 16: Brush.
RWY 34: Brush.

SEWARD
 L-1A, 3D, 4G

SERVICE: LGT ACTVT MIRL Rwy 16-34—CTAF. Bcn rdo ctl.
AIRPORT REMARKS: Unattended. Rapidly rising trrn N, E and W quad. Rwy 16-34 shoulders and safety areas soft when wet; water ponds in safety areas at both ends. Rwy 16-34 marked with reflective cones and lgts.
AIRPORT MANAGER: 907-262-1187
WEATHER DATA SOURCES: AWOS-3P 129.05 (907) 573-5002.
COMMUNICATIONS: CTAF 122.9

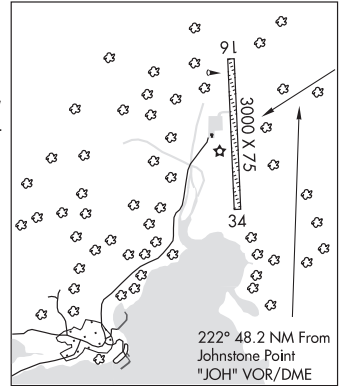


Ⓡ **ANCHORAGE CENTER APP/DEP CON** 133.6
RADIO AIDS TO NAVIGATION: NOTAM FILE JNU.
JOHNSTONE POINT (H) (H) VOR/DME 116.7 JOH Chan 114
 N60°28.86' W146°35.96' 222° 48.2 NM to fld. 48/18E.
 wx cam
 VOR unusable:
 090°-124° byd 23 NM blo 8,000'
 125°-188° byd 10 NM
 DME unusable:
 090°-124° byd 23 NM blo 12,000'
 125°-191° byd 10 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1-866-297-2236.

CHEVAK (VAK)(PAVA) 1 N UTC-9(-8DT) N61°32.45' W165°36.05'
 61 B NOTAM FILE VAK

BETHEL
 L-3B
 IAP

RWY 02-20: 3220X75 (GRVL) MIRL 0.4% up N
RWY 02: REIL. PAPI(P4L)—GA 3.0° TCH 25'.
RWY 20: REIL. PAPI(P4L)—GA 3.0° TCH 25'.
SERVICE: LGT ACTVT MIRL Rwy 02-20—122.8. ACTVT REIL Rwy 02 and Rwy 20, PAPI Rwy 02 and Rwy 20 and rot bcn—CTAF. Nstd white flashing rot bcn.
AIRPORT REMARKS: Unattended. Birds on and invof arpt. Rwy cond unmnt, rcmd visual insp prior to use. Exp strong crosswinds. Rwy 02-20 used as road. First 200 ft of Rwy 02 rough.

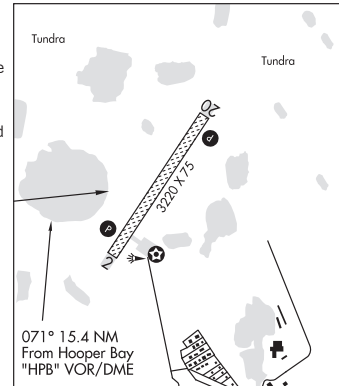

AIRPORT MANAGER: 907-543-2498
WEATHER DATA SOURCES: AWOS-3P 120.625 (907) 858-7600. (WX CAM)
COMMUNICATIONS: CTAF 123.0 UNICOM 122.8
 Ⓡ **ANCHORAGE CENTER APP/DEP CON** 124.5
RADIO AIDS TO NAVIGATION: NOTAM FILE HPB.
HOOPER BAY (H) (H) VOR/DME 115.2 HPB Chan 99 N61°30.86'
 W166°08.07' 071° 15.4 NM to fld. 15/13E.
 VOR unusable:
 358°-013° byd 22 NM blo 3,500'
 DME unusable:
 358°-013° byd 22 NM blo 3,500'

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.