

AVERY CO/MORRISON FLD (See SPRUCE PINE on page 356)

BARRETT'S MOUNTAIN N35°52.13' W81°14.43' NOTAM FILE RDU.
 (H) (H) VOR/DME 113.75 BZM Chan 84(Y) 230° 10.6 NM to Hickory Rgnl. 1880/6W.
 VOR unusable:
 030°-040° byd 15NM blo 8,500'
 RCO 122.1R 113.75T (RALEIGH RADIO)

CHARLOTTE
L-25D

BEAUFORT

MICHAEL J SMITH FLD (MRH)(KMRH) 1 N UTC-5(-4DT) N34°44.03' W76°39.62'
 10 B TPA—See Remarks LRA NOTAM FILE MRH

CHARLOTTE
H-9C, L-35B
IAP

RWY 08-26: H5004X100 (ASPH) D-60 MIRL
RWY 08: REIL. PAPI(P2L)—GA 3.0° TCH 45'. Brush.
RWY 26: REIL. PAPI(P2R)—GA 3.0° TCH 43'. Thld dsplcd 289'. Road. Rgt tfc.
RWY 03-21: H4192X150 (ASPH) S-12.5 MIRL
RWY 03: PAPI(P2L)—GA 4.0° TCH 44'. Thld dsplcd 864'. Road.
RWY 21: PAPI(P2L)—GA 4.0° TCH 54'. Thld dsplcd 516'. Trees. Rgt tfc.
RWY 14-32: H4001X100 (ASPH) S-12.5
RWY 14: Brush.
RWY 32: Thld dsplcd 490'. Trees.

SERVICE: S4 FUEL 100LL, JET A1+ OX 3, 4 LGT ACTIVATE REIL Rwy 08 and Rwy 26; PAPI Rwy 03 and Rwy 21; MIRL Rwy 03-21 and Rwy 08-26—CTAF. PAPI Rwy 08 and Rwy 26 opr continuously.

NOISE: Noise abatement procedures in effect, ctc amgr 252-728-1928. Mil acft Rwy 08-26 required for noise abatement. Avoid overflights of Beaufort Waterfront and Beaufort National Register Historic District.

AIRPORT REMARKS: Attended 1300Z±-dusk. For service after hours call 843-465-2846. Deer and birds on and invof arpt and bird-dropped shells may cause FOD. Skydiving operations - do not overfly arpt. TPA—single engine 1000 ft AGL, twin engine 1500 ft AGL. No line of sight btwn rwy ends.

AIRPORT MANAGER: 252-728-1928

WEATHER DATA SOURCES: ASOS 135.375 (252) 728-2055.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **CHERRY POINT APP/DEP CON** 132.575

CLNC DEL 125.65

CLEARANCE DELIVERY PHONE: For CD ctc Cherry Point Apch at 252-466-5960.

RADIO AIDS TO NAVIGATION: NOTAM FILE ISO.


KINSTON (L) VORTAC 117.5 ISO Chan 122 N35°22.26' W77°33.50' 136° 58.4 NM to fld. 70/5W.

VOR unusable;

Blw 5,000'

Byd 10NM

COMM/NAV/WEATHER REMARKS: Due to volume of mil tfc and trng rcmd all acft using MRH ctc Cherry Point App 132.57 AB and 125.65 prior to MRH dep.

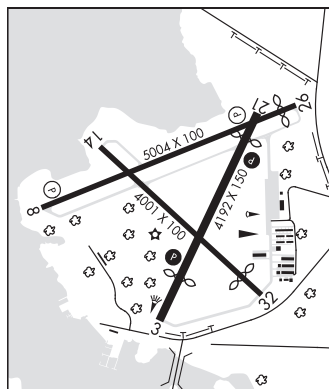

BILLY MITCHELL (See HATTERAS on page 319)

BLADENBORO (3W6) 0 E UTC-5(-4DT) N34°32.57' W78°46.69'
 116 NOTAM FILE RDU

CHARLOTTE

RWY 02-20: 2850X135 (TURF) 0.6% up N

RWY 02: Trees.

RWY 20: Trees.

AIRPORT REMARKS: Unattended. Rwy 20 has 94 ft trees 124 ft from thr offset 32 ft right of cntrln and 96 ft trees 260 ft from thr offset 95 ft left of cntrln. 80 ft trees west edge of rwy thr to thr and 80 ft trees east edge of Rwy 02 fm thr to 500 ft. 20 ft wide by 10 ft deep drainage canal crosses Rwy 02 10 ft south of thr. 3 ft side drainage ditches both sides of rwy at rwy edges. Rwy 02-20 usable rwy width is 125 ft.

AIRPORT MANAGER: (910) 876-4225

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.