

## LANCASTER

**KIRK AIR BASE** (T73) 5 SE UTC-5(-4DT) N34°40.46' W80°40.94'

CHARLOTTE

578 NOTAM FILE AND

**RWY 15-33:** H2600X40 (ASPH) S-8 LIRL

**RWY 33:** Tree.

**SERVICE:** S4 FUEL 100LL LGT For LIRL Rwy 15-33 call 803-286-8800.

**AIRPORT REMARKS:** Attended 1300-2330Z $\ddagger$ . Rwy 15 has 30' drop at thld. Rwy 33 has 10' drop at thld.

**AIRPORT MANAGER:** 803-286-8800

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Charlotte Apch at 704-359-0241.

**WATERWAY 05W-23W:** 4400X300 (WATER)

**WATERWAY 16W-34W:** 3000X300 (WATER)

**WATERWAY 11W-29W:** 2245X600 (WATER)

**SEAPLANE REMARKS:** Waterways 05-23, 11-29 and 16-34 water lanes are not marked, lengths change with water levels ctc arpt mgr and check NOTAM's.

**LANCASTER CO-MC WHIRTER FLD** (LKR)(KLR) 4 W UTC-5(-4DT) N34°43.37'

CHARLOTTE

W80°51.28'

H-9B, 12G, L-24J, 25D, 36E

486 B NOTAM FILE AND

IAP

**RWY 06-24:** H6004X101 (CONC) S-44, D-60, 2D-118

PCN 15 R/B/X/T MIRL 0.4% up NE

**RWY 06:** REIL. PAPI(P2L)—GA 3.0° TCH 41'. Thld dspcd 105'. Tree.

**RWY 24:** REIL. PAPI(P2L)—GA 3.15° TCH 39'. Tree.

**SERVICE:** FUEL 100LL, JET A LGT ACTVT REIL Rwy 06 & 24; MIRL Rwy 06-24—CTAF. PAPI Rwy 06 and Rwy 24 opr consly.

**AIRPORT REMARKS:** Attended 1230-2000Z $\ddagger$ . Deer on and invof arpt. For fuel after hrs call 803-285-1513. 25' drop, 250' fm thr Rwy 06. Small acct must be on a tie down. Arl applicators not pmtd due to pavement conds. Lndg fee.

**AIRPORT MANAGER:** (803) 285-1513

**WEATHER DATA SOURCES:** AWOS-3 120.825 (803) 286-6444.

**COMMUNICATIONS:** CTAF/UNICOM 122.725

Ⓜ CHARLOTTE APP/DEP CON 120.05

GCO 121.725 (CHARLOTTE APCH)

**CLEARANCE DELIVERY PHONE:** For CD ctc Charlotte Apch at 704-359-0241.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE CLT.

CHARLOTTE (L) (L) VOR/DME 115.0 CLT Chan 97 N35°11.42'

W80°57.11' 175° 28.4 NM to fld. 732/5W.

DME portion unusable:

015°-050° byd 25 NM blo 3,000'

050°-100° byd 25 NM blo 2,500'

185°-202° byd 15 NM


203°-220°

270°-350° byd 20 NM blo 5,000'

VOR/DME controlled by Charlotte ATCT

VOR unusable:

203°-220°

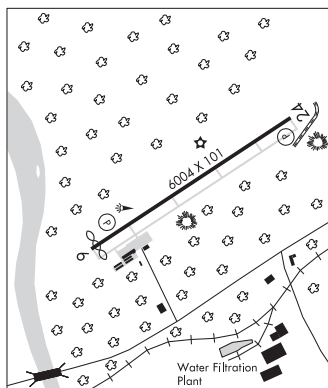

## LANDRUM

**FAIRVIEW** (33A) 3 SE UTC-5(-4DT) N35°09.44' W82°07.43'

ATLANTA

1046 NOTAM FILE AND

**RWY 14-32:** H2770X30 (ASPH) S-6.5 LIRL 0.4% up NW

**RWY 14:** Bldg. Rgt tfc.

**RWY 32:** Pole.

**SERVICE:** LGT ACTIVATE LIRL Rwy 14-32—CTAF.

**AIRPORT REMARKS:** Unattended. Twy markings are of wrong color. Rwy 14-32 is very bumpy with excessive patches along entire sfc length. Rwy 14-32 rwy pavement has failed in several spots. Caution should be used to land at this airfield.

**AIRPORT MANAGER:** 864-879-0123

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Greer Apch at 864-877-8275. When Greer Apch clsd, for CD ctc Atlanta ARTCC at 770-210-7692.