

**MC LAUGHLIN SPB** (See CHESTER on page 338)

**MECKLENBURG—BRUNSWICK RGNL** (See SOUTH HILL on page 374)

## MELFA

**ACCOMACK CO** (MFV)(KMFV) 1 W UTC-5(-4DT) N37°38.81' W75°45.66'

48 B TPA—See Remarks NOTAM FILE MFV

**RWY 03-21:** H5000X100 (ASPH) S-26 MIRL

**RWY 03:** REIL. PAPI(P2L)—GA 3.0° TCH 40'. Tree.

**RWY 21:** REIL. PAPI(P2L)—GA 3.0° TCH 40'. Tree.

**SERVICE:** FUEL 100LL, JET A LGT MIRL Rwy 03-21 preset low intst; incr instst & actvt REIL Rwys 03 & 21—CTAF.

**AIRPORT REMARKS:** Attended 1330-2230Z†. Deer on and invof arpt.

Self-serve fuel (100LL and Jet A) avbl 24hrs. TPA—898(850) lgt actf, 1548(1500) hvy actf. After hours access to restrooms.

**AIRPORT MANAGER:** 757-787-4600

**WEATHER DATA SOURCES:** AWOS-3 118.175 (757) 787-5660.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ **PATUXENT APP/DEP CON** 127.95 (1200-0400Z† Mon-Sun. Other times by NOTAM) other times ctc

Ⓡ **POTOMAC APP/DEP CON** 127.2

GCO 135.075 (NORFOLK CLNC DEL)

**CLEARANCE DELIVERY PHONE:** For CD ctc Patuxent Apch at 301-342-3740, when Patuxent Apch is clsd ctc Potomac Apch at 866-640-4124.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DCA.

**CAPE CHARLES (L) (L) VORTACW** 112.2 CCV Chan 59 N37°20.85' W75°59.86' 042° 21.2 NM to fld. 10/10W.

TACAN AZIMUTH unusable:

005°-015° byd 20 NM blo 4,000'

VOR unusable:

137°-322° byd 17 NM blo 2,000'


137°-322° byd 22 NM blo 3,000'

DME unusable:

005°-015° byd 20 NM blo 4,000'

LOC/DME 110.15 I-MFV Chan 38(Y) Rwy 03.

**WASHINGTON**  
H-101, 121, L-361  
IAP

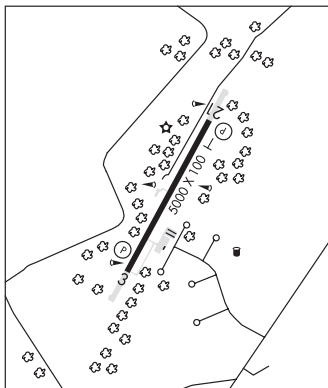

**MIDDLE PENINSULA RGNL** (See WEST POINT on page 380)

## MONETA

**SMITH MOUNTAIN LAKE** (W91) 4 SE UTC-5(-4DT) N37°06.46' W79°35.55'

892 B NOTAM FILE DCA

**RWY 05-23:** H3058X50 (ASPH) MIRL 1.2% up NE

**RWY 05:** Thid dsplcd 250'. Trees.

**RWY 23:** Tree.

**SERVICE:** S4 FUEL 100LL LGT ACTVT MIRL Rwy 05-23—CTAF.

**AIRPORT REMARKS:** Attended continuously. Parachute Jumping. Deer on and

invof arpt. 24 hr self-serve fuel available with credit card. Clsd to

transient practice landings. Rwy 05-23 clsd to transient actf

performing TGL and PLA. Rwy 05 mrkgs wrong size arrows. Rwy 23

mrkgs wrong rwy width. Ldg fee for all actf over 5500 lbs published

max GW.

**AIRPORT MANAGER:** 540-297-4859

**COMMUNICATIONS:** CTAF/UNICOM 122.975

Ⓡ **ROANOKE APP/DEP CON** 135.0

**RADIO AIDS TO NAVIGATION:** NOTAM FILE LYH.

**LYNCHBURG (L) (L) VORW/DME** 109.2 LYH Chan 29 N37°15.27' W79°14.18' 248° 19.2 NM to fld. 871/5W.

VOR unusable:

020°-025°

200°-210°

301°-360°

**COMM/NAV/WEATHER REMARKS:** ROA twr svcs avbl at 540-563-1307.

**CINCINNATI**  
L-26J  
IAP

