FORT WORTH ALLIANCE (AFW)(KAFW) 14 N UTC–6(–5DT) N32°59.42′ W97°19.17′
723 B LRA ARFF Index—See Remarks NOTAM FILE AFW

RWY 16R–34L: H11010X150 (CONC–GRVD) D–200, 2S–175, 2D–400, 2D/2D2–870 PCN 82 R/B/W/T HIRL
RWY 16R: REIL. PAPI(P4R)—GA 3.0° TCH 75′. Railroad. Rgt tfc. 0.4% down.
RWY 34L: REIL. PAPI(P4L)—GA 3.0° TCH 74′. Thld dsplcd 601′. Fence. 0.7% up.
RWY 16L–34R: H11000X150 (CONC–GRVD) D–200, 2S–175, 2D–400, 2D/2D2–870 PCN 82 R/B/W/T HIRL CL
RWY 16L: ALSF2. TDZL. RVR–TMR Rgt tfc. 0.4% down.
RWY 34R: MALSR. TDZL. RVR–TMR P–line. 0.7% up.

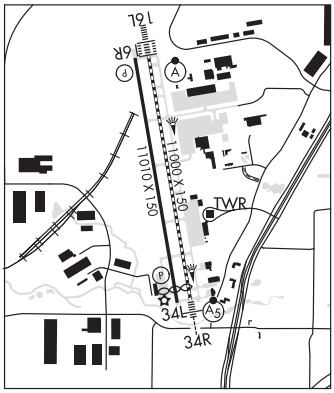

RUNWAY DECLARED DISTANCE INFORMATION
RWY 16L: TORA–10600 TODA–10600 ASDA–10600 LDA–10600
RWY 16R: TORA–11010 TODA–11010 ASDA–10410 LDA–10410
RWY 34L: TORA–11010 TODA–11010 ASDA–11010 LDA–10409
RWY 34R: TORA–11000 TODA–11000 ASDA–11000 LDA–11000

SERVICE: S4 **FUEL** 100LL, JET A1+ **OX** 4
AIRPORT REMARKS: Attended continuously. Class IV, ARFF Index A. ARFF Index E available. PPR for air carrier ops with more than 30 passenger seats, call 817–890–1000 or 800–318–9268. Last 1084′ Rwy 34R not available for accelerate stop and landings. Portions of Twy H movement area east of Twy A is not visible from twr. Prior arrangements required for airframe or power plant repairs for design group III and above. U.S. Customs user fee arpt. Flight Notification Service (ADCUS) available.
AIRPORT MANAGER: 817-890-1000
WEATHER DATA SOURCES: ASOS (817) 491–6188
COMMUNICATIONS: ATIS 126.925
RGNL APP/DEP CON 118.1 124.3 125.2 125.8 125.9 135.975
ALLIANCE TOWER 120.825 (Helicopters) 135.15 **CLNC DEL** 128.725 **GND CON** 132.65
AIRSPACE: CLASS D svc continuous.
RADIO AIDS TO NAVIGATION: NOTAM FILE FTW.
RANGER (H) VORTACW 115.7 FUZ Chan 104 N32°53.37′ W97°10.77′ 305° 9.3 NM to fld. 638/6E.
ILS/DME 110.15 I–UPE Chan 38(Y) Rwy 16L. Class IIIE. DME also serves Rwy 34R. DME unusable 23° left of course.
ILS/DME 110.15 I–JVX Chan 38(Y) Rwy 34R. Class ID. DME also serves Rwy 16L.
COMM/NAV/WEATHER REMARKS: Emerg frequency not available. ARINC frequency 129.75 avbl.