ILS RWY 19L (SA CAT I)
TAMPA INTL (TPA)

LOC I-TPA	APP CRS	Rwy Idg	8300
110.3	187°	TDZE	26
		Apt Elev	26

Simultaneous approach authorized. RADAR required. Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH.

ALSF-2

MISSED APPROACH: Climb to 600 then climbing left turn to 2800 on heading 160° and on PIE VORTAC R-138 to GIBBS INT/PIE 29.3 DME and hold.

ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45		128.475	118.5 307.175	119.5 269.4	121.7 269.4	133.6	

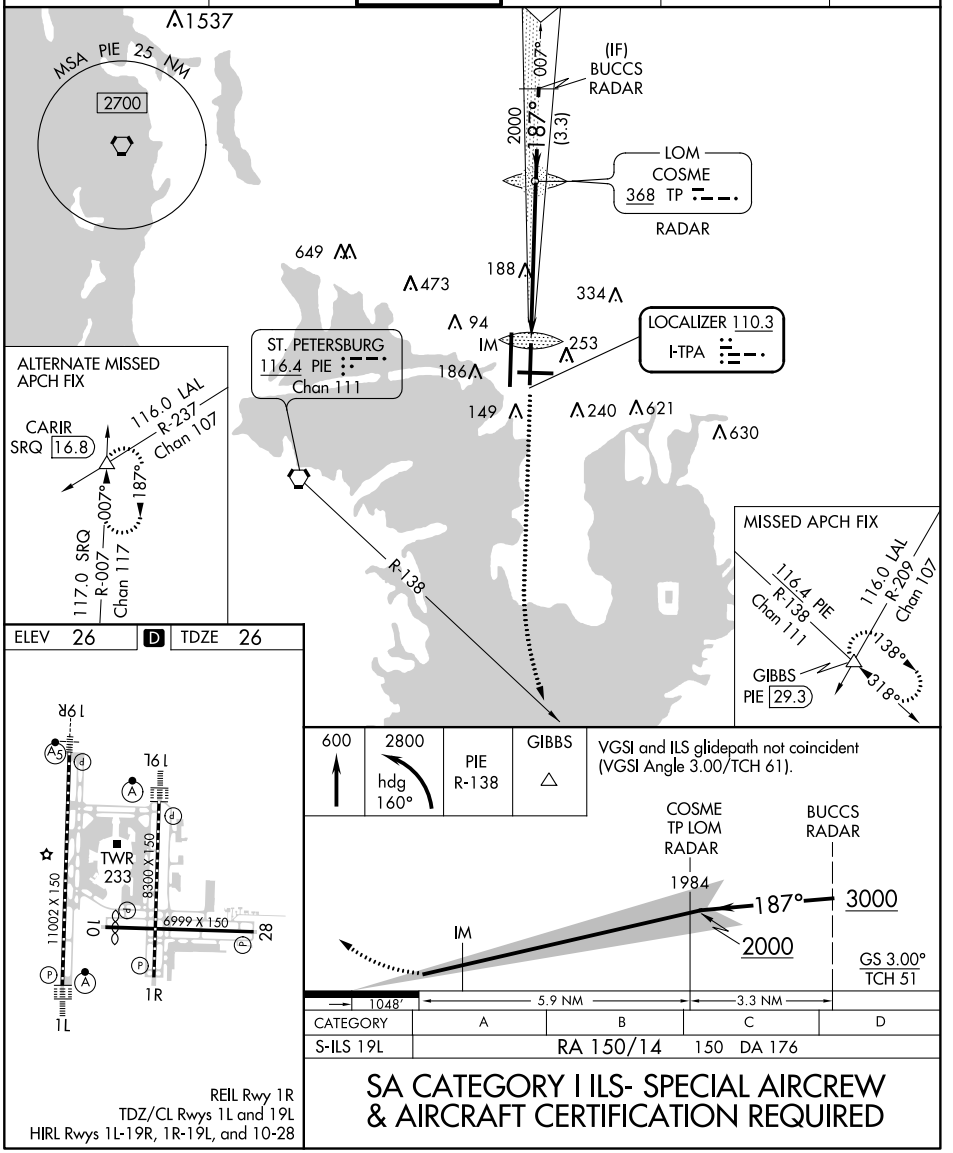

CATEGORY	A	B	C	D
S-ILS 19L	RA 150/14		150	DA 176

SA CATEGORY I ILS- SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

SE-3, 15 JUL 2021 to 12 AUG 2021
SE-3, 15 JUL 2021 to 12 AUG 2021