CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS D.
RADIO AIDS TO NAVIGATION: NOTAM FILE LFI.
(L) TACAN Chan 70 LFI (112.3) N37°05.13´ W76°21.56´ at fld. 7/10W.
TACAN AZIMUTH unusable:
252°–278° byd 20 NM
278°–342°
357°–033° byd 20 NM
DME unusable:
103°–165° byd 30 NM
252°–278° byd 20 NM
278°–342°
357°–033° byd 20 NM
ILS 109.9 I–LFI Rwy 08. No NOTAM MPs unsked; for sys downtimes coord thru 1 oss/osa
ILS 109.9 I–ABM Rwy 26. Class IB. No NOTAM MPs unsked; for sys downtimes coord thru 1 oss/osa.

LAWRENCEVILLE

BRUNSWICK CO (LVL)(KLVL) 3 E UTC–5(–4DT) N36°46.37´ W77°47.66´ **WASHINGTON**
329 B NOTAM FILE DCA **L–36G**
RWY 18–36: H3020X50 (ASPH) S–12.5 MIRL 0.6% up N **IAP**
RWY 18: Pole.
RWY 36: Road.
RWY 06–24: 1890X70 (TURF) 1.7% up NE
RWY 06: Tree.
RWY 24: Tree.
SERVICE: **LGT** MIRL Rwy 18–36 dalgt ops only. Svc PCL all U/S perm.
AIRPORT REMARKS: Attended Fri–Sun 1300–2100Z‡. Arpt attended irregularly. Arpt attended Memorial Day, Independence Day and Labor Day. Rwy 06–24 CLOSED permly. Deer on and invof arpt. Rwy 18 markings in poor condition. No visible centerline. Old Rwy 36 displaced threshold markings showing thru.
AIRPORT MANAGER: 434-848-2767
WEATHER DATA SOURCES: AWOS–3 119.625 (434) 848–2017.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ**WASHINGTON CENTER APP/DEP CON** 118.75
RADIO AIDS TO NAVIGATION: NOTAM FILE DCA.
LAWRENCEVILLE (L) (L) VORTACW 112.9 LVL Chan 76 N36°49.08´ W77°54.18´ 125° 5.9 NM to fld. 350/8W.
VOR unusable:
090 blo 7,000´
090 byd 20 NM
091°–105°
106 blo 7,500´
106 byd 27 NM
107°–170°
171°–280° blo 6,000´
201°–325° byd 17 NM blo 9,000´
326°–089°
TACAN AZIMUTH unusable:
Blw 3,000´
VOR OTS indef
DME unusable:
Blw 3,000´

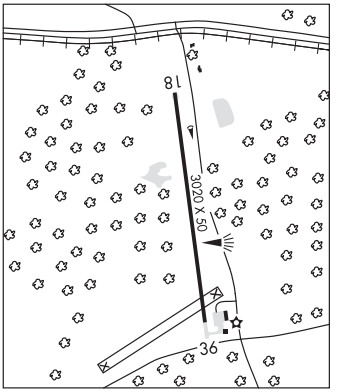

LEE CO (See JONESVILLE on page 349)