SPICEWOOD (88R) 2 E UTC–6(–5DT) N30°28.43´ W98°07.29´ **SAN ANTONIO**
830 NOTAM FILE SJT **L–19C**
RWY 17–35: H4185X38 (ASPH) S–12.5
RWY 17: Thld dsplcd 464´. Tree.
RWY 35: Trees.
SERVICE: **FUEL** 100LL, JET A **LGT** No runway or txwy lighting.
AIRPORT REMARKS: Attended irregularly. Arpt clsd at night exc for hel, medevac and mil flts. Arpt clsd to jet and turbo jet acft, exc for very light jets. Arpt clsd to tgl, ultralights and hang gldrs. Arpt clsd to acft over 12,500 GWT. Be alert for deer on and invof arpt. Arpt/rwy not perimeter fenced. Narrow rwy with soft, unimproved edges. Non–paved sfcs extremely soft ground. Vehicular tfc on twys. No line of sight btn rwy ends. Rwy 17 calm wind rwy. No rotocraft ops less than 500 AGL north of Rwy 17 thr to avoid residential area. No rotocraft ops practice or autorotation ops allowed. Rotocraft arr and dep fly dctly to and fm prkg to avoid unec low–level txg.
AIRPORT MANAGER: 830-201-3111
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc Austin Apch at 512-369-7865.
RADIO AIDS TO NAVIGATION: NOTAM FILE AUS.
CENTEX (VH) (H) VORTACW 112.8 CWK Chan 75 N30°22.71´ W97°31.79´ 275° 31.2 NM to fld. 593/6E.
VOR unusable:
180°–190° byd 40 NM
200°–210° byd 40 NM

STAMFORD

ARLEDGE FLD (F56) 4 SE UTC–6(–5DT) N32°54.63´ W99°44.05´ **DALLAS–FT WORTH**
1561 B NOTAM FILE FTW **L–17B**
RWY 17–35: H3707X60 (ASPH) S–4 MIRL **IAP**
RWY 17: Road.
RWY 08–26: 2211X50 (TURF)
RWY 08: Road.
RWY 13–31: 1702X50 (TURF–GRVL) 0.3% up NW
RWY 13: Road.
RWY 31: Road.
SERVICE: S4 **FUEL** 100LL **LGT** Actvt MIRL Rwy 17–35—CTAF.
AIRPORT REMARKS: Unattended. Farm equipment invof arpt. Rwys 08–26 and 13–31 have rough sfc.
AIRPORT MANAGER: 325-773-2591
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ**ABILENE APP/DEP CON** 127.2
CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.
RADIO AIDS TO NAVIGATION: NOTAM FILE ABI.
ABILENE (VH) (H) VORTACW 113.7 ABI Chan 84 N32°28.88´ W99°51.81´ 004° 26.5 NM to fld. 1809/10E.
VOR unusable:
163°–236° byd 40 NM blo 18,000´
237°–247° byd 40 NM blo 7,000´
248°–250° byd 40 NM blo 18,000´
251°–255° byd 40 NM blo 4,500´
251°–255° byd 46 NM blo 18,000´

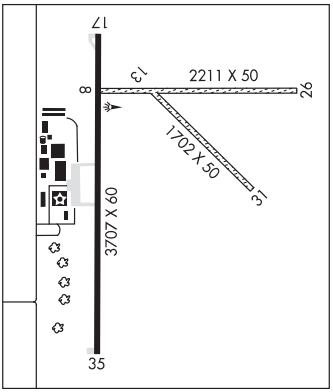

STANTON MUNI (63F) 3 NW UTC–6(–5DT) N32°10.41´ W101°49.35´ **DALLAS–FT WORTH**
2731 NOTAM FILE SJT **L–6H**
RWY 16–34: H4240X60 (ASPH) S–14
RWY 16: Road. Rgt tfc.
RWY 34: Road.
SERVICE: **LGT** Bcn OTS indefly.
AIRPORT REMARKS: Unattended. Nmrs 389´ wind turbines 1.25–3 mi NW, NE and E of arpt. Rwy 16–34 extensive cracking and loose stones.
AIRPORT MANAGER: 432-756-3301
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc midland Apch at 432-563-2123. when Apch clsd ctc Fort Worth ARTCC at 817-858-7584.
RADIO AIDS TO NAVIGATION: NOTAM FILE MAF.
MIDLAND (L) (L) VORTACW 114.8 MAF Chan 95 N32°00.56´ W102°11.42´ 051° 21.2 NM to fld. 2860/11E.
VOR unusable:
010°–020° byd 8 NM blo 8,000´