CLAREMONT MUNI (CNH)(KCNH)   1 W   UTC–5(–4DT)   N43º22.23´ W72º22.09´

544   B   NOTAM FILE BGR
RWY 11–29: H3098X100 (ASPH)   S–30   MIRL   0.3% up E
  RWY 11: Thld dsplcd 1055´.
  RWY 29: REIL. PAPI(P2L)—GA 4.0º TCH 31´.
SERVICE: S2   **FUEL** 100LL   **LGT** Rotg bcn dfclt to see fm the N when foliage is on the trees. Actvt REIL Rwy 29; MIRL Rwy 11–29—CTAF.
AIRPORT REMARKS: Attended Mon–Fri 1500–2100Z‡. For arpt svcs, call 603–542–2282. Wildlife on and invof arpt. Fuel self svc 24 hrs by credit card. Expect downdraft on apch to Rwy 29. Tkof, lndg, and tax on unpaved areas prohibited. Cold temperature airport. Altitude correction required at or below –25C. Haz bcns on surrounding hills.
AIRPORT MANAGER: (603) 542-5156
COMMUNICATIONS: CTAF/UNICOM 122.7
Ⓡ**BOSTON CENTER APP/DEP CON** 134.7
CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.
RADIO AIDS TO NAVIGATION: NOTAM FILE BGR.
  NDB (MHW) 233   CNH   N43º22.15´ W72º22.27´   at fld. 527/16W.
  NDB unusable:
    005º–049º byd 20 NM
    050º–004º byd 15 NM
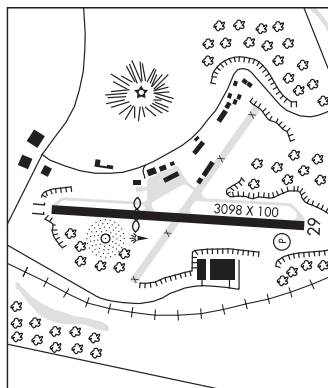 **LEBANON (L) DME** 113.7   LEB   Chan 84   N43º40.73´ W72º12.96´   200º 19.7 NM to fld. 1443.   NOTAM FILE LEB.
  DME unusable:
    045º–075º byd 36 NM blo 10,000´
    091º–119º byd 30 NM blo 7,500´
    161º–304º byd 30 NM blo 6,300´

3098 X 100

COLEBROOK

GIFFORD FLD (4C4)   1 SW   UTC–5(–4DT)   N44º53.25´ W71º30.46´

1017   NOTAM FILE BGR
RWY 04–22: 2423X60 (TURF)   0.5% up NE
  RWY 04: Thld dsplcd 433´. Trees.
  RWY 22: Road.
AIRPORT REMARKS: Unattended. Rwy 04–22 CLOSED Nov–May exc ski acft. Call 603–237–4914 for afld conditions. Rwy 04–22 strip soft in spring. DT wet areas all year. Road traverses rwy 425´ from Rwy 04 thld. Rwy 04 edges and ends marked with yellow cones. Rwy 04 dsplcd thld marked with three yellow cones aligned perpendicular to each rwy edge. 7´ crops immediately west of rwy dur summer. Rwy 22 edges and ends marked with yellow cones.
AIRPORT MANAGER: 603 237-4914
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.