YUMA, ARIZONA

HI-TACAN Z RWY 3L

TACAN NYL Chan 84	APCH CRS 039°	Rwy ldg 13,300 TDZE 195 Arpt Elev 213	AL-511 [USN]	YUMA MCAS/YUMA INTL (KNYL)

MISSED APPROACH: Climbing left turn to 4000, intercept NYL TACAN R-022 to JIBUN, cross JIBUN at or above 4000.

ATIS★	APP CON	TOWER★	GND CON	CLNC DEL	ASR/PAR
118.8 273.5	124.7 371.975	119.3 (CTAF) L 377.075	121.9 314.0	118.0 336.4	

Knots	60	120	180	240	300	360
V/V(fpm)	325	650	975	1300	1625	1950

ATC climb of 325 ft/NM to 4000

Request holding from Los Angeles ARTCC prior to frequency change to MCAS Yuma Approach Control.

CAUTION:
R-2507 and R-2512 located approximately 33 NM/28 NM NW respectively of NYL TACAN.

CAUTION:
Short intmed, recommended early configuration.

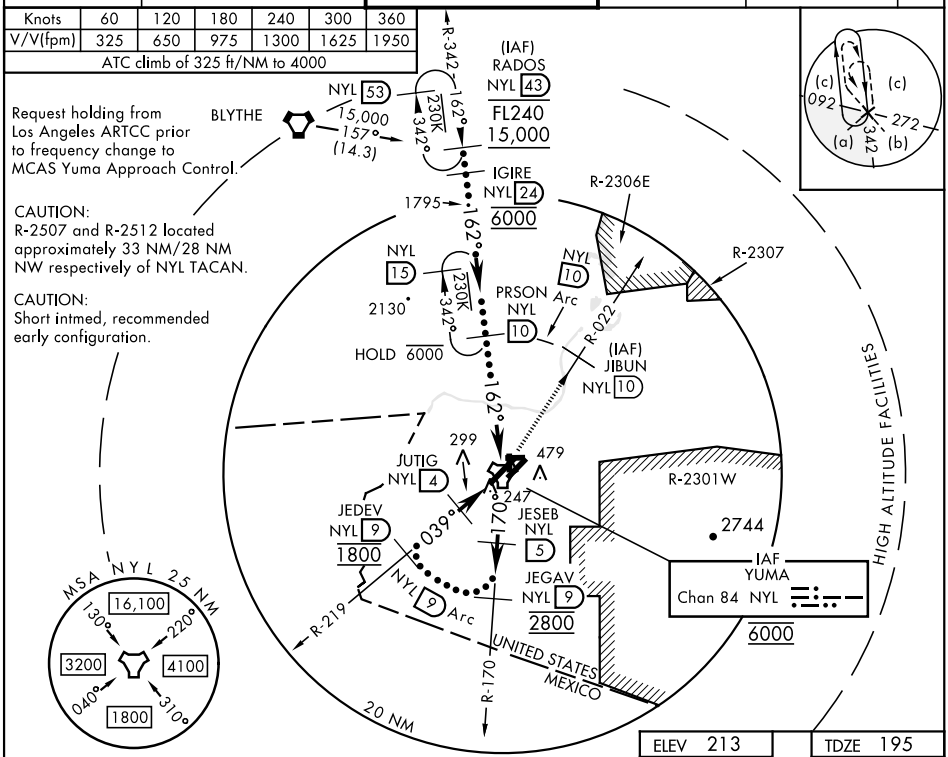

EMERG SAFE ALT 100 NM 17,100

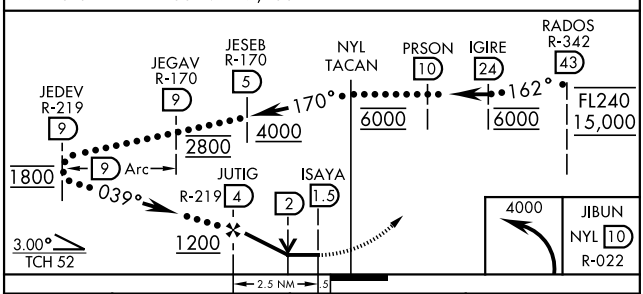

CATEGORY	C	D	E
S-3L	560-1	365	(400-1)
C CIRCLING	800-1½ 587 (600-1½)	800-2 587 (600-2)	

ELEV 213	TDZE 195
3L-21R	13,300 x 200
3R-21L	9239 x 150
8-26	6146 x 150
17-35	5710 x 150

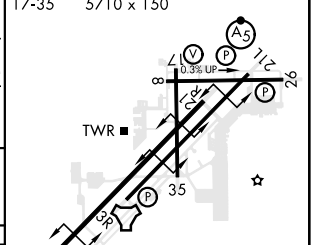

REIL Rwy 3R-21L, 3L, 35
HIRL Rwy 3R-21L and 3L-21R
HIRL Rwy 8-26 and 17-35 L

SW-4, 07 SEP 2023 to 05 OCT 2023

SW-4, 07 SEP 2023 to 05 OCT 2023