RAMONA (RNM)(KRNM) 2 W UTC–8(–7DT) N33º02.35´ W116º54.92´ **LOS ANGELES**
1395 B TPA—See Remarks NOTAM FILE RNM **H–4I, L–4H**
RWY 09–27: H5001X150 (ASPH) S–75, D–95, 2D–170 MIRL **IAP, AD**
RWY 09: PAPI(P2L)—GA 3.5º TCH 51´.
RWY 27: REIL. PAPI(P2L)—GA 3.5º TCH 32´.

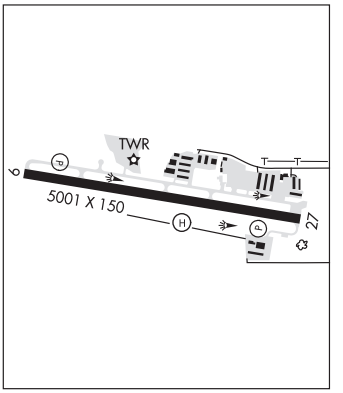

SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTIVATE REIL Rwy 27, MIRL Rwy 09–27 and twy lgts—CTAF. PAPI Rwy 09 and Rwy 27 operates 24 hrs. Rwy 09 VGSI unusbl byd 3 NM due to terrain.
NOISE: Voluntary jet curfew 0600–1500Z‡. Noise sensitive are NE–SE. Noise abatement, tkf climb on rwy heading until 1900´ MSL.
AIRPORT REMARKS: Attended 1600–0400Z‡. Be alert for birds year round, various size and species. Ocnl coyote on or invof of rwy and twy. PPR for all military acft ctc arpt manager. Repetitive copter trng conducted on helipads south of rwy and Twy A west of tower. West tsnt ramp adj to ATCT rstrd to acft less than 12500 lbs. Fire fighting acft on and invof arpt. Air tankers in vicinity year–round frequently fly nstd pattern entries. TPA—2395(1000) single engine, 2895(1500) multi–engine. For fire fighting activity call arpt manager. Rwy 27 calm wind rwy.
AIRPORT MANAGER: 760-788-3366
WEATHER DATA SOURCES: ASOS (760) 789–7699
COMMUNICATIONS: CTAF 119.875 **ATIS** 132.025 **UNICOM** 122.95
Ⓡ **SOCAL APP CON** 132.2
TOWER 119.875 (1600–0400Z‡) **GND CON** 121.65
Ⓡ **SOCAL DEP CON** 127.3
CLEARANCE DELIVERY PHONE: For CD when ATCT clsd ctc SoCal Apch at 800-448-3724.
AIRSPACE: CLASS D svc 1600–0400Z‡; other times CLASS G.
RADIO AIDS TO NAVIGATION: NOTAM FILE SAN.
JULIAN (VL) (L) VORTACW 114.0 JLI Chan 87 N33º08.43´ W116º35.16´ 235º 17.7 NM to fld. 5560/15E.
VOR unusable:
007º–010º byd 40 NM
336º–339º byd 40 NM
344º–355º byd 40 NM
356º–006º byd 40 NM blo 14,500´
356º–006º byd 70 NM
COMM/NAV/WEATHER REMARKS: When twr clsd acft must self–announce on CTAF prior to ldg or tkof.

• • • • • • • • • • • • • • • • • •

HELIPAD H1: H340X66 (ASPH–CONC)
HELIPORT REMARKS: Helipad parking N of rwy not open to public. Helicopter skid ldgs on rwy and twy prohibited. Helipad ops to helipad south of rwy restricted to 6,000 lbs or less. Helipad S of rwy unlgtd. Helipad S of rwy daytime VFR use only.

RANCHO MURIETA (RIU)(KRIU) 1 W UTC–8(–7DT) N38º29.21´ W121º06.17´ **SAN FRANCISCO**
144 TPA—944(800) NOTAM FILE RIU **L–2F, 3A**
RWY 04–22: H3798X75 (ASPH)
RWY 04: VASI(V2L)—GA 3.0º TCH 12´. Road. Rgt tfc.
RWY 22: VASI(V2L)—GA 3.0º TCH 12´. Tree.
SERVICE: **FUEL** 100LL, JET A **LGT** Rwy 04 VASI OTS indef. Arpt lgts opr 1600–0100Z‡.
NOISE: Rwy 22 noise abatement procedures in effect, ctc arpt manager 916–354–2940.
AIRPORT REMARKS: Attended 1600–0100Z‡. Deer on and invof rwy. +30´ obstruction lit power poles parallel to Rwy 04–22. All ultralights must comply with FAR 103 and have an operating acft radio. All transient acft rqrd to park in designated transient area. Ldg fees apply. Pstn single $25, pstn twin $40, turbo prop $75, jet $100.
AIRPORT MANAGER: 916-354-2940
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc NorCal Apch at 916-361-6874.
RADIO AIDS TO NAVIGATION: NOTAM FILE SAC.
SACRAMENTO (VH) (H) VORTACW 115.2 SAC Chan 99 N38º26.62´ W121º33.10´ 066º 21.3 NM to fld. 3/17E.
VOR unusable:
031º–041º byd 40 NM blo 5,000´
031º–041º byd 45 NM blo 18,000´
157º–169º byd 40 NM blo 4,500´
157º–169º byd 56 NM blo 18,000´
246º–251º byd 40 NM
252º–262º byd 40 NM blo 7,000´
252º–262º byd 65 NM
263º–269º byd 40 NM
353º–013º byd 40 NM blo 5,000´
353º–013º byd 49 NM blo 5,500´
353º–013º byd 58 NM