NORMAN

UNIVERSITY OF OKLAHOMA WESTHEIMER (OUN)(KOUN) P (ARNG) 3 NW UTC–6(–5DT) **DALLAS–FT WORTH H–6H, L–15D IAP, AD**
N35°14.73´ W97°28.33´
1182 B TPA—See Remarks NOTAM FILE OUN
RWY 18–36: H5199X100 (ASPH–GRVD) S–30, D–50, 2D–100 MIRL
RWY 18: MALSR. PAPI(P4L)—GA 3.0° TCH 55´. Rgt tfc.
RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 40´.
RWY 03–21: H4748X100 (ASPH) S–30, D–50, 2D–100 MIRL
RWY 03: MALS. PAPI(P4L)—GA 3.0° TCH 40´.
RWY 21: PAPI(P4L)—GA 3.0° TCH 40´. Rgt tfc.

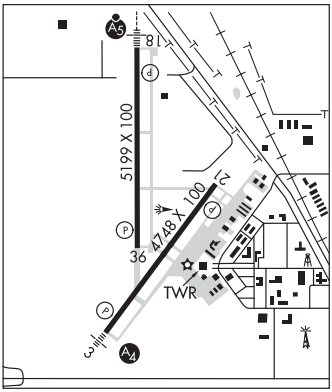

SERVICE: S4 **FUEL** 100LL, JET A **LGT** When twr clsd, ACTIVATE MIRL Rwy 03–21 and Rwy 18–36; REIL Rwy 36; MALSR Rwy 18; MALS Rwy 03—CTAF. **MILITARY— FUEL** A+ (avbl 1300–0400Z‡, C405–329–8062, OT 2 hr PN C405–623–2099, $60 fee.) (NC–100LL, A)
AIRPORT REMARKS: Attended 1200–0400Z‡. Ctn: Coyotes and birds on and invof rwys. High density student ops invof arpt and 5 miles south. 180° turns prohibited on runways for all other than single engine light aircraft. TPA for hels 1682(500), Single engine 2182(1000); Multi–engine and jets 2682(1500). Lndg fee: Spl event fee for all acft the day before and day of a university home football game.
AIRPORT MANAGER: 405-325-7233
WEATHER DATA SOURCES: AWOS–3PT 119.55 (405) 325–7302.
COMMUNICATIONS: CTAF 118.0 **UNICOM** 122.95
NORMAN RCO 122.4 (MC ALESTER RADIO)
Ⓡ**OKE CITY APP/DEP CON** 120.45
TOWER 118.0 (1400–0400Z‡) **GND CON** 121.6
CLEARANCE DELIVERY PHONE: For CD ifun to ctc twr, ctc Oke City Apch at 405-681-5683.
AIRSPACE: CLASS D svc 1400–0400Z‡; other times CLASS E.
RADIO AIDS TO NAVIGATION: NOTAM FILE OKC.
WILL ROGERS (H) (H) VORTACW 114.1 IRW Chan 88 N35°21.52´ W97°36.55´ 128° 9.5 NM to fld. 1230/7E.
TACAN AZIMUTH unusable:
297°–315°
LOC/DME 111.1 I–PHY Chan 48 Rwy 03. LOC/DME unmonitored when ATCT clsd.
ILS/DME 111.95 I–BWM Chan 56(Y) Rwy 18. Class IE. DME unusable byd 30° left of course.

NOWATA MUNI (H66) 2 NE UTC–6(–5DT) N36°43.26´ W95°37.52´ **KANSAS CITY**
679 NOTAM FILE MLC
RWY 17–35: H2500X45 (ASPH) S–4
RWY 17: Trees.
RWY 35: Trees.
RWY 05–23: 2440X45 (TURF)
RWY 05: P–line.
RWY 23: Trees.
AIRPORT REMARKS: Unattended. Rwy 05–23 clsd indefly, unusbl. Rwy unusbl. Rwy 05–23 unidentifiable; pline and road cross rwy. Rwy extremely rough & covered with tall grass & hay bales. Connector twy and apron pvmt failed. –2 ft ditch at Rwy 23 thld; –12 ft ditch 220 ft fm Rwy 35 thld. NOTE: See Special Notices—Aerobatic Practice Area.
AIRPORT MANAGER: (918) 273-3538
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Kansas City ARTCC at 913-254-8508.

OILLR N36°05.85´ W95°53.33´ NOTAM FILE TUL. **KANSAS CITY**
NDB (LOMW) 338 TU 357° 6.0 NM to Tulsa Intl. 710/3E.