GILA BEND AF AUX (GXF)(KGXF) AF 3 S UTC–7 N32º53.27´ W112º43.18´ **PHOENIX**
AIRSPACE: CLASS D svc 1430–0630Z Mon–Fri, 1500–2359Z wkend, clsd hol; other times CLASS G. **H–4J, L–5B**

GILA BEND MUNI (E63) 2 E UTC–7 N32º57.61´ W112º40.42´ **PHOENIX**
789 B TPA—1589(800) NOTAM FILE PRC **H–4J, L–5B, A**

RWY 04–22: H5200X75 (ASPH) S–12.5 MIRL 0.3% up NE
RWY 04: PAPI(P2L)—GA 3.0º TCH 40´. Tree.
RWY 22: PAPI(P2L)—GA 3.0º TCH 40´. Tree.

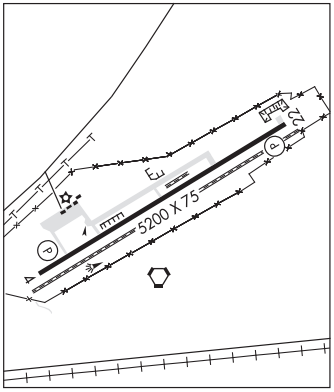

SERVICE: **FUEL** 100LL **LGT** Actvt MIRL Rwy 04–22—CTAF. CTAF lighting OTS indef. Airport lighted windsock out of service indef. Airport beacon out of service indef. Intens Rwy Lights: Rwy 04–22 and twy lighting system out of service indef.

AIRPORT REMARKS: Unattended. 100LL self svc H24 with credit card. Rwy 04–22 primary sfc, +5–20 ft brush and trees, 100–125 ft S of cntrln. Area parl rwy narrows to 30´ at culvert. NOTE: See Special Notices—Restricted Area R–2305, Gila Bend, Arizona Transit Information.

AIRPORT MANAGER: 623-810-4662

COMMUNICATIONS: CTAF/UNICOM 122.8
RCO 122.1R 116.6T (PRESCOTT RADIO)

CLEARANCE DELIVERY PHONE: For CD ctc Luke Apch at 623-856-7361. If una ctc Albuquerque ARTCC at 505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE PRC.
(VH) (H) VORTAC 116.6 GBN Chan 113 N32º57.38´ W112º40.46´ at fld. 790/14E.
TACAN AZIMUTH unusable:
360º–010º byd 25 NM
VOR unusable:
091º–101º byd 40 NM blo 18,000´
102º–114º byd 40 NM blo 6,500´
102º–114º byd 53 NM blo 15,000´
102º–114º byd 79 NM
115º–189º byd 40 NM
211º–213º byd 40 NM
287º–292º byd 40 NM
293º–303º byd 40 NM blo 18,000´
304º–331º byd 40 NM
352º–090º byd 40 NM