ST JOHNS INDUSTRIAL AIR PARK (SJN)(KSJN) 1 N UTC–7 N34º31.11´ W109º22.73´ **PHOENIX**
5737 B NOTAM FILE SJN **H–4K, L–8H**
RWY 14–32: H5322X75 (ASPH) S–90 MIRL **IAP**
RWY 14: REIL. PAPI(P2L)—GA 3.0º TCH 40´.
RWY 32: REIL. PAPI(P2R)—GA 3.0º TCH 40´. Thld dsplcd 92´. Pole.
RWY 03–21: H3400X60 (ASPH) S–55 MIRL
RWY 03: Thld dsplcd 190´. Tree.
SERVICE: **FUEL** 100LL, JET A+ **LGT** ACTVT REIL Rwy 14 and Rwy 32, PAPI Rwy 14 and Rwy 32, MIRL Rwy 03–21 and Rwy 14–32—CTAF.
AIRPORT REMARKS: Attended 1400–0000Z. Rwy 03 200 ft gravel clear area. Rwy 14–32 parl twy reflectors full len both sides. Rwy 32 calm wind rwy. Rwy 03 markings faded and misg. Rwy 21 markings faded and misg. Mil tfc invof arpt.
AIRPORT MANAGER: 928-337-4254
WEATHER DATA SOURCES: ASOS 134.225 (928) 337–3061.
COMMUNICATIONS: CTAF/UNICOM 122.8
RCO 122.1R 112.3T (PRESCOTT RADIO)
Ⓡ**ALBUQUERQUE CENTER APP/DEP CON** 124.325
CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Albuquerque ARTCC at 505-856-4561.
RADIO AIDS TO NAVIGATION: NOTAM FILE SJN.
(VH) (H) VORTAC 112.3 SJN Chan 70 N34º25.44´ W109º08.61´ 284º 13.0 NM to fld. 6840/12E.
VOR unusable:
097º–108º byd 40 NM
109º–119º byd 40 NM blo 18,000´
120º–222º byd 40 NM

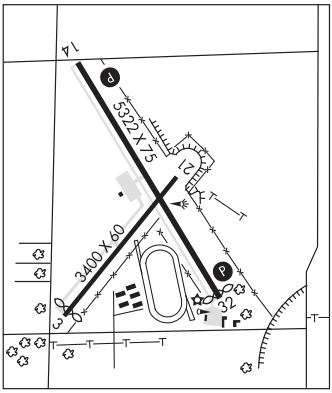

SAN CARLOS APACHE (See GLOBE on page 53)

SAN LUIS

ROLLE AIRFIELD (44A) 5 ENE UTC–7 N32º30.98´ W114º41.90´ **PHOENIX**
163 NOTAM FILE PRC
RWY 17–35: H2800X60 (ASPH)
AIRPORT REMARKS: Unattended. Arpt unlgtd–frequent ngt military flights conducted. Arpt fenced and locked–inaccessible from ground. For access ctc arpt manager 928–941–2396 . Oil treated area surrounding existing paved rwy is heavily rutted. Mil ops require prior permission. Call 928–941–2396 24 hrs. Arpt access controlled with arpt security system. Recommend coordination with Yuma County Airport Authority. Ctc arpt manager 928–941–2396. Rwy 17 and 35 turn–a–rounds are rough, use only the rwy to turn around. PJ actvy on or invof aprt–most actvy on weekends.
AIRPORT MANAGER: 928-726-5882
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Los Angeles ARTCC at 661-575-2079.