ILS or LOC RWY 36L

HUNTSVILLE INTL-CARL T JONES FLD (HSV)

LOC/DME I-ELL	APP CRS	Rwy Idg 12600
108.5	005°	TDZE 616
Chan 22		Apt Elev 629

DME required. RADAR required for procedure entry.

T A ASR Circling NA for Cats C/D/E east of Rwy 18L-36R. Simultaneous approach authorized. For inop ALS, increase S-ILS 36L Cat E visibility to RVR 4000, S-LOC 36L Cat C/D/E visibility to RVR 5500. DME from RQZ VORTAC. DME use requires simultaneous reception of I-ELL and RQZ DME.

MALSR

MISSED APPROACH: Climb to 1100 then climbing left turn to 3000 on heading 350° and RQZ R-261 to TANNE/RQZ 17.6 DME and hold.

ATIS	HUNTSVILLE APP CON ★	HUNTSVILLE TOWER ★	GND CON	CLNC DEL	UNICOM
121.25	125.6 354.1	127.6 (CTAF) L 350.35	121.9 269.525	120.35	122.95

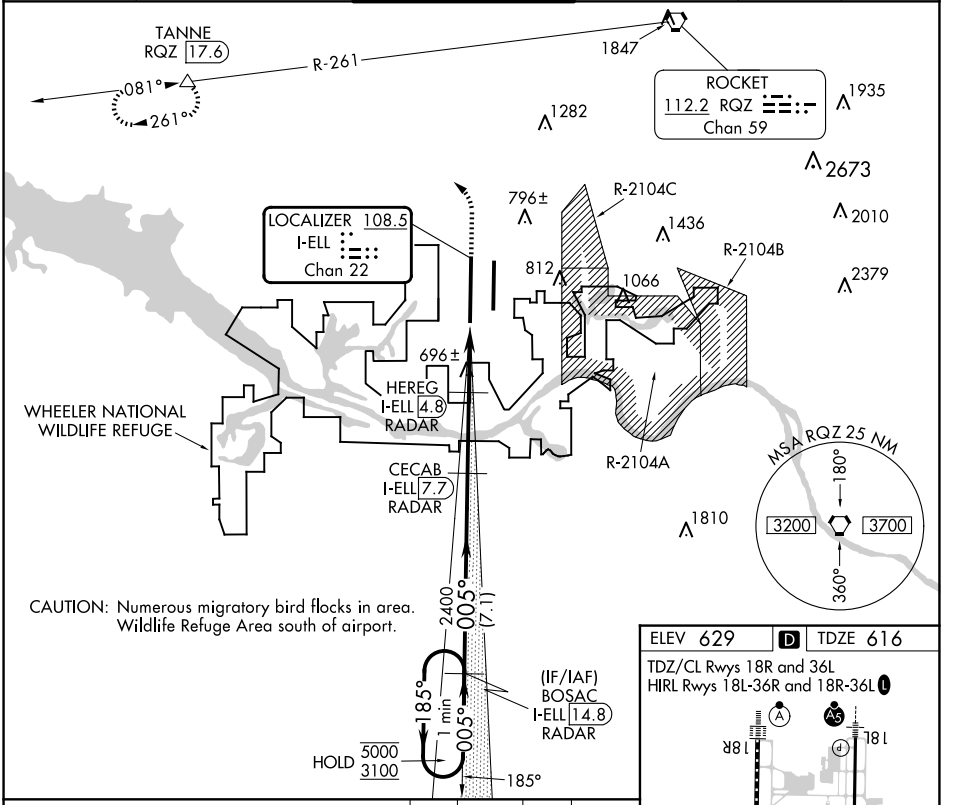

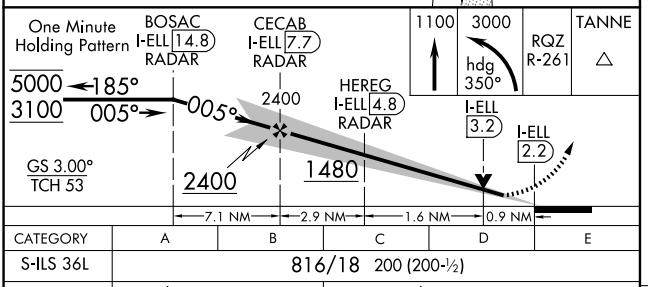

CATEGORY	A	B	C	D	E
S-ILS 36L	816/18 200 (200-½)				
S-LOC 36L	960/24 344 (400-½)		960/30 344 (400-⅝)		
C CIRCLING	1160-1 531 (600-1)		1160-1½ 531 (600-1½)	1240-2 611 (700-2)	1260-2¼ 631 (700-2¼)

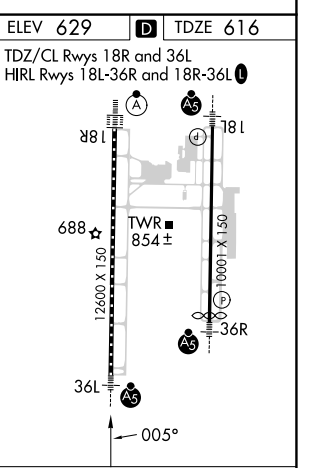

FAF to MAP 5.5 NM

Knots	60	90	120	150	180
Min:Sec	6:42	4:28	3:21	2:41	2:14

SE-4, 20 MAR 2025 to 17 APR 2025
SE-4, 20 MAR 2025 to 17 APR 2025