DEXTER RGNL (1BØ)   3 E   UTC–5(–4DT)   N45º00.27´ W69º14.25´

533   B   NOTAM FILE BGR
RWY 16–34: H3008X75 (ASPH)   S–30   MIRL
RWY 07–25: 1249X120 (TURF)   0.6% up W
SERVICE: FUEL 100LL, MOGAS   **LGT** ACTIVATE MIRL Rwy
16–34—CTAF.
AIRPORT REMARKS: Unattended. 24 hr fuel with major credit card, no
ethanol in MOGAS. Wildlife on or invof arpt.
AIRPORT MANAGER: 207-270-0239
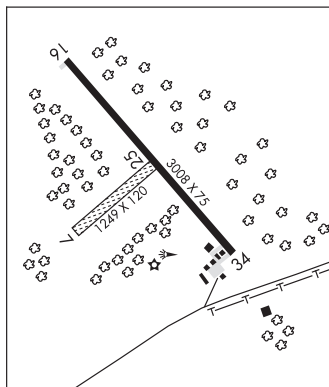**COMMUNICATIONS: CTAF/UNICOM** 122.8
Ⓡ**BANGOR APP/DEP CON** 118.925
CLEARANCE DELIVERY PHONE: For CD ctc Bangor Apch at 207-561-2500 ext
1.
RADIO AIDS TO NAVIGATION: NOTAM FILE BGR.
BANGOR (VH) (H) VORTACW 114.8   BGR   Chan 95   N44º50.51´
W68º52.44´   321º 18.3 NM to fld. 360/19W.

DOVER/FOXCROFT

CHARLES A CHASE JR MEML FLD (44B)   1 SW   UTC–5(–4DT)   N45º10.65´ W69º14.68´

520   NOTAM FILE BGR
RWY 09–27: 2926X75 (TURF)   1.3% up E
RWY 09: Trees.
RWY 27: Trees.
AIRPORT REMARKS: Unattended. Deer on and invof arpt. Rwy 09–27 thlds unmarked and undefined. Rwy 09–27 has 2"+ rock
in center of rwy 400´–600´ from Rwy 9 thld. No line of sight between rwy ends. Rwy 27 +12´ rock and dirt pile 250´
from thld and 90´ right. Rwy 27 +10´ roadway 110´ from thld across the rwy. Rwy 27, +60´ trees 300´ from thld
across apch.
AIRPORT MANAGER: 207-852-1881
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

DUNNS   N44º24.66´ W69º51.64´   NOTAM FILE AUG.

NDB (LOMW) 366   AU   171º 6.1 NM to Augusta State. 238/18W.

EAST WINTHROP

LAKESIDE LODGE AND MARINA SPB (Ø3M)   4 E   UTC–5(–4DT)   N44º18.91´ W69º53.22´

165   NOTAM FILE BGR
WATERWAY 02W–20W: 3800X200 (WATER)
SEAPLANE REMARKS: Attended 1200–0200Z‡. Daytime use only. Hvy boat tfc on wkends. For fuel check at motel. Rwy 02W
end east of lighthouse, Rwy 20W end east of south tip Hershey Island.
AIRPORT MANAGER: 207-395-6741
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Portland Apch at 207-874-7320, when Apch clsd ctc Boston ARTCC at
603-879-6859.

EASTERN SLOPES RGNL