

**HAYWARD EXECUTIVE** (HWD)(KHW) 2 W UTC-8(-7DT) N37°39.54' W122°07.30'

SAN FRANCISCO

52 B TPA—See Remarks NOTAM FILE HWD

H-3B, L-2F, 3B, A

**RWY 10R-28L:** H5694X150 (ASPH-GRVD) S-30, D-75, 2S-95

IAP, AD

MIRL 0.4% up E

**RWY 10R:** REIL. VASI(V4R)—GA 3.0° TCH 25'. Thld dsplcd 816'. Tree.

Rgt tfc.

**RWY 28L:** REIL. VASI(V4L)—GA 4.0° TCH 35'. Thld dsplcd 676'.**RWY 10L-28R:** H3107X75 (ASPH) S-13 MIRL 0.3% up SE**RWY 10L:** PAPI(P4L)—GA 3.0° TCH 29'. Tree.**RWY 28R:** PAPI(P4L)—GA 3.0° TCH 44'. Rgt tfc.**SERVICE:** S4 FUEL 100LL, JET A OX 1, 3 LGT When twr clsd MIRL

Rwy 10R-28L preset low ints, to increase ints ACTIVATE—CTAF.

When twr clsd VASI Rwy 10R and Rwy 28L opr SS-SR, PAPI Rwy 10L,

PAPI Rwy 28R, REIL Rwy 10R and Rwy 28L unavailable.

**AIRPORT REMARKS:** Attended 1600-0100Z†. When tower clsd Rwy

10L-28R CLOSED. Flocks of birds feeding along the shoreline, creek

areas and at the golf course to the north, on occasion may fly across

various parts of the arpt. For restaurant/golf course itmrt acct prkg ctc

arpt ops 510-293-8678. 155' energy complex exhaust stack 1.5 NM

southwest of arpt. Do not overfly energy complex facility below 1,000'

MSL. Noise abatement procedures in effect ctc arpt for noise rules

510-293-8669. TPA-652(600) Rwy 10R-28L, 852(800) Rwy

10L-28R. Rwy 10R has ldg distance remaining signs (lgt) north side of rwy. Rwy 28L has ldg distance remaining signs

(lgt) south side of rwy. Twy A not visible from twr between Twy B and Twy C. Twy A1 clsd to acct with wingspan greater

than 100'. Twy Z1 clsd to acct with wingspan greater than 94'. Transient helicopter tfc use helpads west of green ramp

located at base of twr.

**AIRPORT MANAGER:** (510) 293-8678**WEATHER DATA SOURCES:** ASOS (510) 786-3052**COMMUNICATIONS:** CTAF 120.2 ATIS 126.7 510-786-3988 UNICOM 122.95

Ⓡ NORCAL APP CON 124.4 125.35 134.5

TOWER 120.2 118.9 (1500-0500Z†) GND CON 121.4 CLNC DEL 128.05

Ⓡ NORCAL DEP CON 124.4

**CLEARANCE DELIVERY PHONE:** For CD when ATCT is clsd ctc NorCal Apch at 916-361-0516.**AIRSPACE:** CLASS D svc 1500-0500Z†; other times CLASS G; exc portion contained within Oakland CLASS E (dr).**RADIO AIDS TO NAVIGATION:** NOTAM FILE OAK.

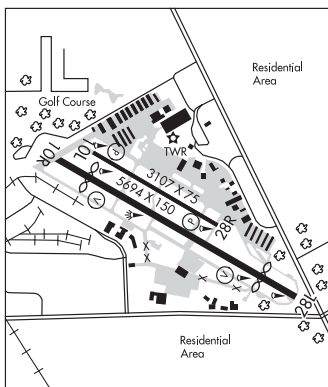
OAKLAND (H) VOR/DME 116.8 OAK Chan 115 N37°43.56' W122°13.42' 113° 6.3 NM to fld. 13/17E.

HIWAS.

DME unusable:

340°-040° byd 30 NM blo 8,000'

LOC/DME 111.5 I-HWD Chan 52 Rwy 28L. Localizer offset angle 3.00 deg. LOC unmonitored when ATCT clsd.

**HEALDSBURG MUNI** (HES)(KHES) 3 NW UTC-8(-7DT) N38°39.17' W122°53.92'

SAN FRANCISCO

280 NOTAM FILE OAK

**RWY 13-31:** H2652X60 (ASPH) S-12.5 MIRL 0.9% up NW**RWY 13:** PAPI(P2L)—GA 4.0° TCH 40'. Road. Rgt tfc.**RWY 31:** PAPI(P2L)—GA 4.0° TCH 20'. Hill.**SERVICE:** S4 FUEL 100LL LGT ACTIVATE MIRL Rwy 13-31—CTAF.**AIRPORT REMARKS:** Attended 1600-0100Z†. No touch and go. Practice ldfs to 3 ops/day. Rwy 31 downdrafts apch end.**AIRPORT MANAGER:** 707-433-8540**COMMUNICATIONS:** CTAF/AUNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Oakland ARTCC at 510-745-3380.