

BERKELEY SPRINGS

POTOMAC AIRPARK (W35) 4 N UTC-5(-4DT) N39°41.56' W78°09.97'

WASHINGTON
L-29D, A
IAP

413 NOTAM FILE EKN

RWY 11-29: H4979X70 (ASPH) MIRL

RWY 11: Trees.

RWY 29: Trees. Rgt tfc.

AIRPORT REMARKS: Attended irregularly. Arpt clsd nghts. Arpt entrance gate locked, no public access to arpt. Birds and wildlife invof arpt.

Unmanned acft 1,000' /blo 1 NM radius of arpt. Remote controlled model acft opr on arpt. No acft over 18,500 lbs. Rwy 11-29 pavement spalling, cracks, uneven sfc. Loose aggregate and stones. Vegetation growing through pavement. Drag racing on rwy. Extensive rubber build up on Rwy 29 pavement end. Rwy 29 end, 12' grandstand on each side of rwy, 13' from rwy edge. Rwy 11 markings faded. Rwy 29 markings faded. Rwy 11 apch end, 30' drop off, 30' from pavement end.

AIRPORT MANAGER: 301-842-3700

COMMUNICATIONS: CTAF 122.9

® **POTOMAC APP/DEP CON** 126.825

CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-709-4993.

RADIO AIDS TO NAVIGATION: NOTAM FILE AOO.

ST THOMAS (L) VORTACW 115.0 THS Chan 97 N39°55.99'
W77°57.06' 222° 17.5 NM to fld. 2338/7W.


HAGERSTOWN (L) VORW 109.8 HGR N39°41.86' W77°51.34' 276° 14.4 NM to fld. 563/7W. NOTAM FILE HGR.

VOR unusable:

251°-280° byd 16 NM blo 4,000'

281°-300° byd 24 NM blo 8,000'

351°-050°

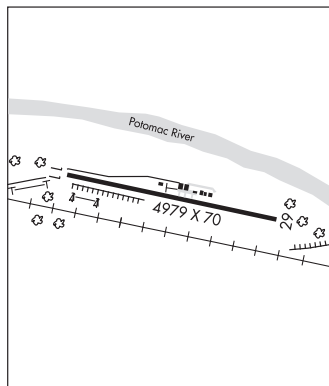

BLUEFIELD

MERCER CO (BLF)(KBLF) 3 NE UTC-5(-4DT) N37°17.76' W81°12.45'

CINCINNATI
L-26I
IAP

2857 B NOTAM FILE BLF

RWY 05-23: H4743X100 (ASPH-GRVD) S-30, D-48 HIRL

RWY 05: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Bldg.

RWY 23: REIL. PAPI(P4L)—GA 3.0° TCH 65'. Trees.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-4743 TODA-4743 ASDA-4743 LDA-4743

RWY 23: TORA-4743 TODA-4743 ASDA-4743 LDA-4743

SERVICE: S4 **FUEL** 100LL, JET A, A+ **LGT** ACTIVATE HIRL Rwy 05-23, PAPI Rwy 05 and Rwy 23, REIL Rwy 05 and Rwy 23 and twy lgts—CTAF.

AIRPORT REMARKS: Attended 1100-0300Z±. Arpt unattended Christmas and New Years. For svcs call 304-921-3417 (line staff cell). After hrs emerg fuel by prior arrangement, listing on line office door. Deer on and invof arpt. Power plant repairs: rotary wing repairs only. Airframe repairs: rotary wing repairs only. Mowing in progress Apr-Nov all sfc. Rwy 23 has steep drop-off 320' from thld outbound. Rwy 05 has steep drop-off 175' from thld left side.

AIRPORT MANAGER: 304-327-5308

WEATHER DATA SOURCES: ASOS 132.725 (304) 327-5766.

COMMUNICATIONS: CTAF 122.9

RCO 122.1R 110.0T (ELKINS RADIO)

BLUEFIELD RCO 122.2 (ELKINS RADIO)

INDIANAPOLIS CENTER APP/DEP CON 126.575

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Indianapolis ARTCC at 317-247-2411.

AIRSPACE: CLASS E svc 1025-0225Z±; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE BLF.

BLUEFIELD (L) VOR/DME 110.0 BLF Chan 37 N37°18.39' W81°11.66' at fld. 2900/3W.


DME unusable:

090°-210° byd 20 NM

VOR unusable:

040°-050° byd 10 NM

ILS 109.5 I-BLF Rwy 23. Class IA. Autopilot coupled apchs na blw 3,600' MSL.

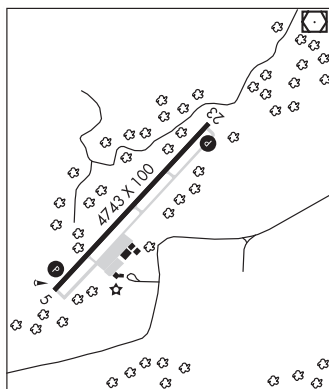

BOGGS FLD (See SPENCER on page 399)