

MOCKSVILLE

TWIN LAKES (8A7) 5 NE UTC-5(-4DT) N35°54.89' W80°27.41'

818 B NOTAM FILE RDU

RWY 09-27: H2943X50 (ASPH) S-12.5 RWY LGTS(NSTD)

1.5% up E

RWY 09: PAPI(P2L)—GA 3.5° TCH 49'. Trees.

RWY 27: Trees.

SERVICE: S4 FUEL 100LL OX 4

AIRPORT REMARKS: Attended 1300-2200Z†. For after hrs svc ctc 336-998-2126. Fuel 24 hr self svc with credit card. Deer/migratory birds occasionally on arpt. Rwy 09 18' drop-off 150' from thld left and rgt of centerline. Rwy 09 uphill grade. Rwy 09-27 markings nonstandard due to size and location.

AIRPORT MANAGER: 336-998-8101

COMMUNICATIONS: CTAF/UNICOM 122.7

® **GREENSBORO APP/DEP CON** 124.35

CLEARANCE DELIVERY PHONE: For CD ctc Greensboro Apch at 336-333-5119.

RADIO AIDS TO NAVIGATION: NOTAM FILE GSO.

GREENSBORO (H) VORTAC 116.2 GSO Chan 109 N36°02.74'

W79°58.58' 255° 24.7 NM to fld. 908/3W.


TACAN AZIMUTH unusable:

255°-290° byd 10 NM blo 6,000'

CHARLOTTE

L-25D, 36F

IAP

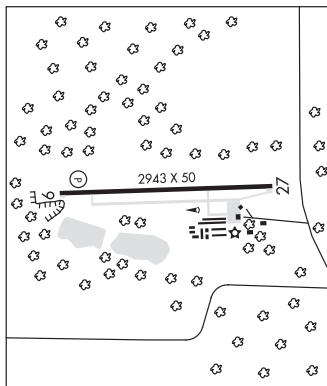

MONROE

CHARLOTTE-MONROE EXEC (EQY)(KEQY) 5 NW UTC-5(-4DT) N35°01.04' W80°37.32'

683 B NOTAM FILE EQY

RWY 05-23: H7001X100 (ASPH) S-35, D-68.5 HIRL 0.3% up SW

RWY 05: MALSR. PAPI(P4L)—GA 3.0° TCH 46'. Trees.

RWY 23: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Trees.

SERVICE: S4 FUEL 100LL, JET A1+ OX 3, 4 LGT ACTVT MALSR Rwy 05; REIL Rwy 23; HIRL Rwy 05-23—122.7. All lights oper dusk-0500Z†. After 0500Z†, ACTVT—122.7. PAPI Rwy 05 & 23 oper continuously.

AIRPORT REMARKS: Attended 1100-0300Z†. Deer, wildlife, and birds on and invof arpt. Fuel 24 hr credit card svc avbl. Arpt phone number 704-226-2300. Rwy end safety area Rwy 23 has 20' dropoff between rwy and Twy A.

AIRPORT MANAGER: 704-226-2300

WEATHER DATA SOURCES: ASOS 135.775 (704) 283-5185.

COMMUNICATIONS: CTAF/UNICOM 122.7

® **CHARLOTTE APP/DEP CON** 120.05

CLNC DEL 132.55

CLEARANCE DELIVERY PHONE: For CD ctc Charlotte Apch at 704-359-0241.

RADIO AIDS TO NAVIGATION: NOTAM FILE CLT.

(L) **VOR/DME** 115.0 CLT Chan 97 N35°11.42'

W80°57.11' 127° 19.3 NM to fld. 732/5W.

DME portion unusable:

015°-050° byd 25 NM blo 3,000'

050°-100° byd 25 NM blo 2,500'

203°-220°

270°-350° byd 20 NM blo 5,000'

VORDME controlled by charlotte ATCT

VOR unusable:


203°-220°

ILS/DME 109.75 I-EQY Chan 34(Y) Rwy 05. Class IB. LOC unmonitored 2200-1300Z†. LOC unusable byd 30' left of course.

CHARLOTTE

H-9B, 12G, L-25D, 36E

IAP

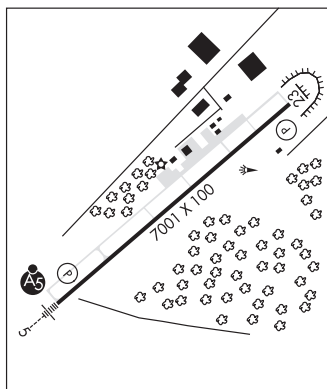

MONTGOMERY CO (See STAR on page 337)

MOORE CO (See PINEHURST/SOUTHERN PINES on page 322)