

LYONS—RICE CO MUNI (LYO)(KLYO) 1 W UTC-6(-5DT) N38°20.42' W98°13.71'

WICHITA
L-10H
IAP

1692 B NOTAM FILE ICT

RWY 17-35: H4401X75 (CONC) S-30 PCN 12 R/C/W/T MIRL
0.4% up N

RWY 17: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Road. Rgt tfc.

RWY 35: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Trees.

SERVICE: S2 **FUEL** 100LL, JET A **LGT** Actvt REIL Rwy 17 and 35; PAPI Rwy 17 and 35; MIRL Rwy 17-35—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z†. Parachute Jumping. For attendance other times on req call 620-257-5002. Fuel available during normal attendance schedule after hours number 785-577-1918. Jet A on request.

AIRPORT MANAGER: 620-257-5002

WEATHER DATA SOURCES: AWOS-3P 119.925 (620) 509-2357.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **KANSAS CITY CENTER APP/DEP CON** 118.8

CLEARANCE DELIVERY PHONE: For CD ctc Kansas City ARTCC at 913-254-8508.


RADIO AIDS TO NAVIGATION: NOTAM FILE HUT.

HUTCHINSON (L)(L) VOR/DME 116.8 HUT Chan 115 N37°59.82' W97°56.05' 322° 24.8 NM to fld. 1542/4E.

VOR unusable:

195°-217° byd 33 NM blo 8,000'

195°-217° byd 16 NM blo 5,000'

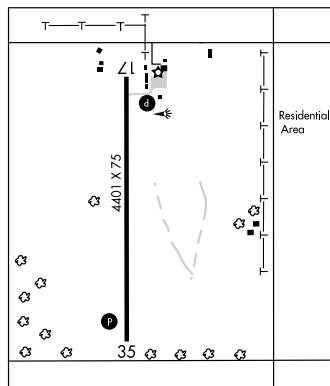

MANHATTAN RGNL (MHK)(KMHK) 4 SW UTC-6(-5DT) N39°08.47' W96°40.31'

KANSAS CITY
H-5C, L-10I
IAP, AD

1066 B TPA—See Remarks ARFF Index—See Remarks NOTAM FILE MHK

RWY 03-21: H7000X150 (CONC-GRVD) S-75, D-110, 2S-175

PCN 44 R/C/W/T HIRL

RWY 03: MALSR. PAPI(P4L)—GA 3.0° TCH 50'. Trees. Rgt tfc.

RWY 21: REIL. PAPI(P4L)—GA 3.0° TCH 47'. Trees.

RWY 13-31: H5001X75 (ASPH-CONC) S-30, D-39 PCN 9 R/C/Y/U

MIRL 0.4% up NW

RWY 13: VASI(V2L)—GA 3.5° TCH 41'. Pole.

RWY 31: REIL. VASI(V4L)—GA 3.0° TCH 42'. Tree. Rgt tfc.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 03: TORA-7000 TODA-7000 ASDA-7000 LDA-7000

RWY 13: TORA-5000 TODA-5000 ASDA-5000 LDA-5000

RWY 21: TORA-7000 TODA-7000 ASDA-7000 LDA-7000

RWY 31: TORA-5000 TODA-5000 ASDA-5000 LDA-5000

SERVICE: S4 **FUEL** 100LL, JET A, MOGAS **LGT** When twr clsd
ACTIVATE MALSR Rwy 03, REIL Rwy 21 and Rwy 31, HIRL Rwy 03-21, MIRL Rwy 13-31—CTAF. PAPI Rwy 03 and Rwy 21, VASI Rwy 13 and Rwy 31 opr continuously.

AIRPORT REMARKS: Attended 1200-0400Z†. Coyotes and deer on and in/ov all rwys. Migratory birds in/ov arpt Mar-May and Sep-Nov. Military airfield 7 miles SW resembles this arpt. Class I, ARFF Index B. Index C equipment avbl upon request. After hrs air carrier ops are not authorized in excess of 15 minutes before or after scheduled arrival or departure time without prior coordination to confirm ARFF services are avbl prior to landing or takeoff. Contact MHK ARFF 785-587-4521. 24 hr PPR for unscheduled air carrier ops with more than 30 pax seats, call airport admin 785-587-4597. Rwy 13-31 not avbl for scheduled acr ops with more than 9 psgr seats or unscheduled acr at least 31 psgr seats. Non-standard air traffic control minima applied IFR arrivals with respect to high performance acft ops conducted within confines of R-3602. TPA—1909 (843) light acft, 2509 (1443) turbine acft.

AIRPORT MANAGER: 785-587-4565

WEATHER DATA SOURCES: ASOS 119.075 (785) 537-1035. LAWRS 1200-0400Z†.

COMMUNICATIONS: CTAF 118.55


RCO 122.65 (WICHITA RADIO)

Ⓡ **MARSHALL AAF GCA APP/DEP CON** 121.25 (Mon-Fri 1400-0700Z†; Fri 1400-2200Z†, exc holidays other times ctc)

Ⓡ **KANSAS CITY CENTER APP/DEP CON** 127.35

TOWER 118.55 (1200-0400Z†) **GND CON** 121.85

CLEARANCE DELIVERY PHONE: For CD if una ctc on FSS freq, ctc Marshall Apch as 785-239-2118. when Marshall Apch is clsd, ctc Kansas City ARTCC at 913-254-8508.

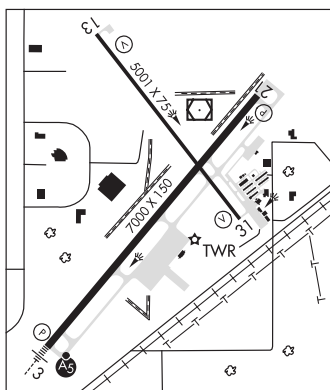

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS D svc 1200-0400Z±; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE MHK.

(T) (T) VOR/DME 110.2 MHK Chan 39 N39°08.73' W96°40.12' at fld. 1044/4E.

DME portion unusable:

232°-002° byd 10 NM blo 3,500'

VOR portion unusable:

262°-284° byd 10 NM blo 3,500'

ILS 111.3 I-MHK Rwy 03. Class IE.

COMM/NAV/WEATHER REMARKS: MULTICOM 122.85 avbl.

MANKATO (TKO)(KTKO) 1 NW UTC-6(-5DT) N39°48.17' W98°13.27'

WICHITA

1859 NOTAM FILE ICT

L-10H

RWY 17-35: H3540X50 (ASPH) LIRL

RWY 17: Fence.

RWY 09-27: 2505X100 (TURF)

RWY 09: Trees.

RWY 27: Road.

AIRPORT REMARKS: Attended Mar-Oct Mon-Fri 1300-2300Z±. At the intersection of Rwy 09-27 and Rwy 17-35 a slight change in elevation may cause a rough crossing. Rwy 09-27 apch end marked with white painted tires. Telephone avbl 24 hrs, local calls only.

AIRPORT MANAGER: 785-378-3942

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE ICT.

(L) (L) VORTACW 109.8 TKO Chan 35 N39°48.38' W98°15.60' 087° 1.8 NM to fld. 1880/10E.

MANKATO N39°48.38' W98°15.60' NOTAM FILE ICT.

WICHITA

(L) (L) VORTACW 109.8 TKO Chan 35 087° 1.8 NM to Mankato. 1880/10E.

L-10H

MARION MUNI (43K) 2 SE UTC-6(-5DT) N38°20.26' W96°59.30'

KANSAS CITY

1390 B NOTAM FILE ICT

RWY 03-21: 2745X95 (TURF)

RWY 03: Fence.

RWY 21: P-line.

RWY 13-31: 2722X50 (TURF)

RWY 13: Fence.

RWY 17-35: H2573X40 (ASPH) LIRL

RWY 18-36: 2310X67 (TURF)

RWY 18: Fence.

SERVICE: FUEL 100LL, MOGAS

AIRPORT REMARKS: Unattended. Rwy 03-21 is slightly rough. Rwy 03 Controlling Obstruction the proximity of the fence to the Rwy establishes the controlling obstruction. The 35' to 40' trees directly behind would be more of a concern for approaching acft. Rwy 17-35 has extensive cracking. Rwy 18-36 thld delineated with yellow painted tires. Rwy 03-21 and Rwy 13-31 edges marked with yellow painted tires.

AIRPORT MANAGER: 620-382-3703

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Kansas City ARTCC at 913-254-8508.

MARK HOARD MEML (See LEOTI on page 113)