

**PERRYTON OCHILTREE CO** (PYX)(KPYX) 3 E UTC-6(-5DT) N36°24.78' W100°45.09'

**WICHITA**  
H-6G, L-15C  
IAP

2918 B NOTAM FILE PYX

**RWY 17-35:** H5701X75 (ASPH) S-12.5 MIRL

**RWY 17:** PAPI(P4L)—GA 3.0° TCH 40'. Pole.

**RWY 35:** VASI(V2L)—GA 3.5° TCH 23'. Road.

**RWY 04-22:** 3280X144 (TURF)

**RWY 22:** P-line.

**SERVICE:** S4 **FUEL** 100LL, JET A1+ **LGT** Dusk-dawn. MIRL Rwy

17-35 preset low intst; to incr intst and actvt PAPI 17 —CTAF.

**AIRPORT REMARKS:** Attended Mon-Sat 1400-2300Z†, Sun 1900-2300Z†.

For 100LL fuel aft hrs call 806-435-4226 or 806-228-5573. Rwy

04-22 thrs mkd with buried plates. Sfc rough with lrg animal holes.

Rwy 04-22 south 1000' clsd indefly. 2280' avbl.

**AIRPORT MANAGER:** 806-435-4226

**WEATHER DATA SOURCES:** AWOS-3 118.175 (806) 435-9963.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ **KANSAS CITY CENTER APP/DEP CON** 126.95

**CLEARANCE DELIVERY PHONE:** For CD ctc Kansas City ARTCC at 913-254-8508.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE LBL.


**LIBERAL (H) (H) VORTACW** 112.3 LBL Chan 70 N37°02.66'

W100°58.27' 153° 39.3 NM to fld. 2891/11E.

TACAN AZIMUTH unusable:

240°-280°

**NDB (MHW) 266 PYX** N36°24.74' W100°44.86' at fld. 2917/7E. NOTAM FILE PYX.

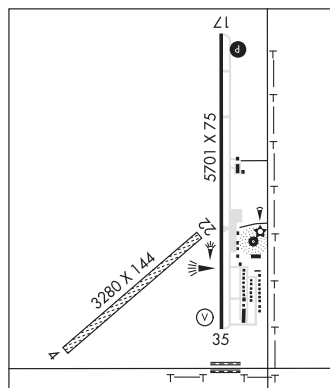

**PINCK** N33°16.99' W97°11.78' NOTAM FILE DTO.

**DALLAS-FT WORTH**

**NDB (LOMW) 257 DT** 178° 4.9 NM to Denton Enterprise. 739/4E.

**PINELAND MUNI** (T24) 1 SW UTC-6(-5DT) N31°14.01' W93°58.91'

**HOUSTON**  
L-19E, 21A

260 B NOTAM FILE CXO

**RWY 17-35:** H3700X75 (ASPH) S-14 MIRL

**RWY 17:** Trees.

**RWY 35:** Trees.

**SERVICE:** **LGT** ACTIVATE MIRL Rwy 17-35—CTAF.

**AIRPORT REMARKS:** Unattended. Extensive pavement cracking with vegetation growing thru. Loose aggregate on rwy. Rwy 17-35 no markings.

**AIRPORT MANAGER:** 409-584-2390

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc Houston ARTCC at 281-230-5622.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE LFK.

**LUFKIN (H) (H) VORTACW** 112.1 LFK Chan 58 N31°09.75' W94°43.01' 078° 38.1 NM to fld. 207/5E.

TACAN AZIMUTH & DME unusable:

260°-275° byd 30 NM

275°-260° byd 30 NM blo 2,500'

## PLAINS

**YOAKUM CO** (F98) 1 NW UTC-6(-5DT) N33°13.03' W102°49.81'

**ALBUQUERQUE**  
H-6G, L-6H  
IAP

3705 B NOTAM FILE FTW

**RWY 03-21:** H5001X75 (ASPH) MIRL 0.6% up NE

**RWY 21:** Pole.

**RWY 17-35:** H3924X60 (ASPH) S-12.5 MIRL

**RWY 17:** P-line.

**RWY 35:** Pole.

**SERVICE:** **FUEL** 100LL **LGT** Dusk-Dawn. MIRL Rwy 03-21 and 17-35 preset low intst; to incr intst actvt—CTAF.

**AIRPORT REMARKS:** Attended irregularly. 100LL fuel self serve.

**AIRPORT MANAGER:** (806) 456-7491

**COMMUNICATIONS:** CTAF 122.9

Ⓡ **FORT WORTH CENTER APP/DEP CON** 132.6

**CLEARANCE DELIVERY PHONE:** For CD ctc Fort Worth ARTCC at 817-858-7584.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE HOB.

**HOBBS (L) (L) VORTACW** 111.0 HOB Chan 47 N32°38.29' W103°16.16' 021° 41.2 NM to fld. 3664/11E.