

**JIM HAMILTON L B OWENS** (CUB)(KCUB) P (AR) 2 S UTC-5(-4DT) N33°58.23' W80°59.72'

CHARLOTTE

193 B TPA—See Remarks NOTAM FILE CUB

H-9B, 12G, L-24I

**RWY 13-31:** H5011X75 (ASPH) S-44.5, D-66 PCN 15 F/B/X/T MIRL

IAP

**RWY 13:** REIL. PAPI(P2L)—GA 4.0° TCH 30'. Tree. Rgt tfc.**RWY 31:** REIL. PAPI(P2R)—GA 3.0° TCH 20'. Thld dspcd 391'. Tree.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 13:** TORA-4999 TODA-4999 ASDA-4999 LDA-4999**RWY 31:** TORA-4999 TODA-4999 ASDA-4999 LDA-4599**SERVICE:** S4 FUEL 100LL, JET A OX 1, 2 LGT ACTIVATE MIRL Rwy 13-31 and REIL Rwy 13 and 31—CTAF. PAPI Rwy 13 unusable byd 8 deg right. **MILITARY—**FUEL A+ (1100-0300Z, C803-771-7915, OT C803-771-7915.) (NC-100LL, A)**NOISE:** Avoid noise sensitive area north of arpt blo 1500 ft. No northbound dep turns either rwy blo 1500 ft.**AIRPORT REMARKS:** Attended 1100-0300Z. For svc after hrs call 803-771-7915. Due to proximity and rwy alignment, aircrews have mistaken CAE Rwy11-29 for CUB Rwy 13-31 which is 6 miles SW. TPA: 807' AGL/1000' MSL. Railroad switching yard parallel to Rwy 13-31. Rwy to twy separation is 206'. The separation design criterion is not fully met for acct 12,500 lbs and larger.**AIRPORT MANAGER:** 803-771-7915**WEATHER DATA SOURCES:** ASOS 118.675 (803) 929-0665.**COMMUNICATIONS:** CTAF/UNICOM 123.075Ⓡ **COLUMBIA APP/DEP CON** 133.4

CLNC DEL 124.4

**CLEARANCE DELIVERY PHONE:** For CD ctc Columbia Apch at 803-822-5242 or 803-822-5040.**RADIO AIDS TO NAVIGATION:** NOTAM FILE CAE.**COLUMBIA (H) (H) VORTAC** 114.7 CAE Chan 94 N33°51.44' W81°03.23' 025° 7.4 NM to fld. 404/2W.

VOR unusable:

000°-073° byd 35 NM blo 6,000'

200°-234° byd 12 NM blo 3,000'

235°-245° byd 12 NM blo 6,000'

246°-289° byd 12 NM blo 3,000'

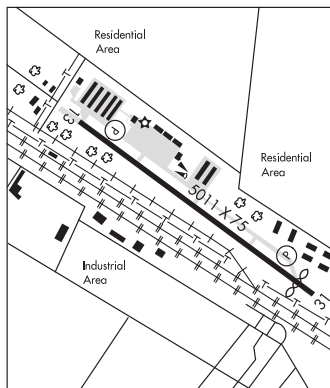
290°-305° byd 12 NM blo 2,400'

306°-344° byd 30 NM

345°-359° byd 10 NM blo 5,000'

**LOC/DME** 110.9 I-CUB Chan 46 Rwy 31.

ASR

**CONWAY—HORRY CO** (HYW)(KHYW) 3 W UTC-5(-4DT) N33°49.71' W79°07.33'

CHARLOTTE

35 B NOTAM FILE AND

L-24I, 35A

**RWY 04-22:** H4401X75 (ASPH) S-12.5, D-20 MIRL

IAP

**RWY 04:** REIL. PAPI(P4R)—GA 3.35° TCH 48'. Tree.**RWY 22:** REIL. PAPI(P4L)—GA 3.0° TCH 43'. Tree.**SERVICE:** S4 FUEL 100LL, JET A, A+ LGT Actvt MIRL Rwy 04-22—CTAF.**AIRPORT REMARKS:** Attended 1400-2200Z. Fuel 24 hrs credit card self svc avbl.**AIRPORT MANAGER:** 843-448-1580**WEATHER DATA SOURCES:** AWOS-3 119.525 (843) 397-8046.**COMMUNICATIONS:** CTAF/UNICOM 122.7Ⓡ **MYRTLE BEACH APP/DEP CON** 127.4 (1100-0400Z)**JAX CENTER APP/DEP CON** 134.375 (0400-1100Z)**CLEARANCE DELIVERY PHONE:** For CD ctc Myrtle Beach Apch at 843-477-2727 or 843-477-2704, when Apch clsd ctc Jacksonville ARTCC at 904-845-1592.**RADIO AIDS TO NAVIGATION:** NOTAM FILE CRE.**GRAND STRAND (H) (H) VORTAC** 114.4 CRE Chan 91 N33°48.83' W78°43.47' 276° 19.9 NM to fld. 27/3W.

TACAN AZIMUTH unusable:

296°-335°

DME unusable:

296°-335°

VOR unusable:

296°-308° byd 30NM blo 5,000'

**HORRY NDB (MHW)** 370 HYW N33°49.40' W79°07.69' at fld. 27/8W. NOTAM FILE AND. NDB unmonitored.