

TIFFIN, OHIO

AL-5645 (FAA)

20086

VORTAC FBC 108.2 Chan 19	APP CRS 073°	Rwy Idg 4000 TDZE 786 Apt Elev 786
--	------------------------	---


VOR RWY 6
SENECA COUNTY (16G)

DME required.


T Circling to Rwy 24 NA at night. Rwy 6 helicopter reduction below $\frac{3}{4}$ SM NA. When
A NA local altimeter not received, use Findlay altimeter setting and increase all MDA 60
feet and S-6 Cat C visibility $\frac{1}{8}$ SM and Circling Cat C visibility $\frac{1}{4}$ SM.

MISSED APPROACH: Climb to 2400 then left turn on FBC VORTAC R-073 to REBUT/FBC 21 DME and hold.

AWOS-3 127.175	FDY ASOS 132.85	TOLEDO APP CON 120.8 317.55	UNICOM 123.0 (CTAF) 0
--------------------------	---------------------------	---------------------------------------	---------------------------------

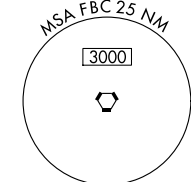


Procedure NA for arrival on FBC
VORTAC airway radials 081 CW 134.

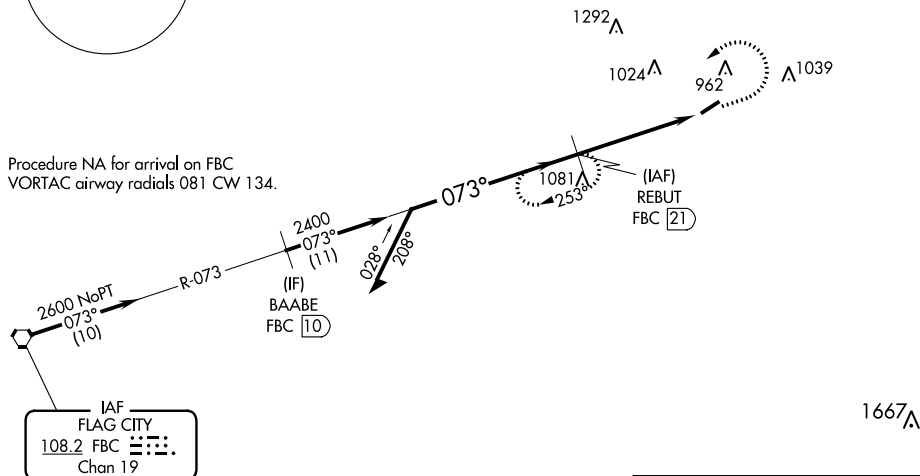

EC-2, 27 JAN 2022 to 24 FEB 2022

EC-2, 27 JAN 2022 to 24 FEB 2022

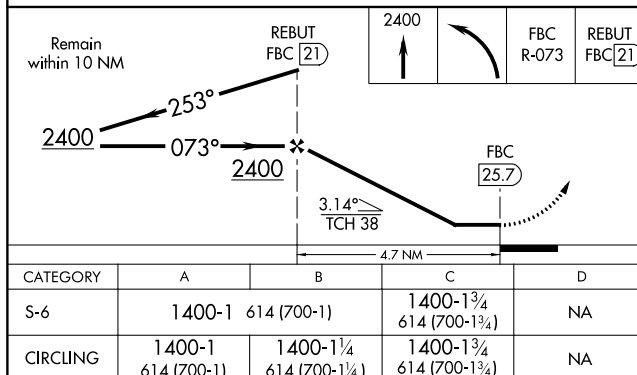

TIFFIN, OHIO
Amdt 9B 19JUL18

41°06'N-83°13'W

SENECA COUNTY (16G)
VOR RWY 6