

APP CRS	Rwy Idg	7569
055°	TDZE	708
	Apt Elev	727

RNAV (RNP) Z RWY 5

BUFFALO NIAGARA INTL (BUF)


▼

For uncompensated Baro-VNAV systems, procedure below -18°C (0°F) or above 54°C (130°F). GPS required. For inoperative MALSR, increase RNP 0.10 all Cnts visibility to 1¼ . For inoperative MALSR, increase RNP 0.30 all Cnts visibility to 1½.

MALSR

MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to TRAVA and hold.

D-ATIS	BUFFALO APP CON	BUFFALO TOWER	GND CON	CLNC DEL	CPDLC
135.35	126.15 263.125	120.5 257.8	133.2 257.8	124.7 257.8	

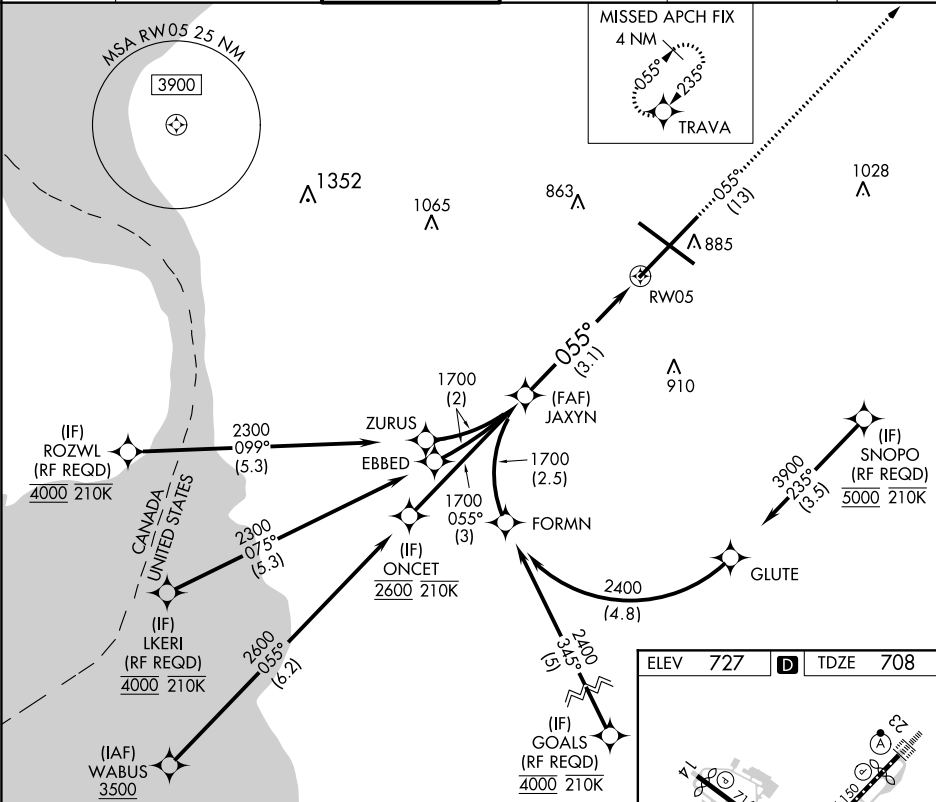

JAXYN See planview for multiple IF locations 3000 ↑ TRAVA ✱				
1700 GP 3.00° TCH 46 1700 055° 3.1 NM RW05				
CATEGORY	A	B	C	D
RNP 0.10 DA	1065/45 357 (400-¾)			
RNP 0.30 DA	1159/60 451 (500-1¼)			
AUTHORIZATION REQUIRED				

