

BESSEMER, ALABAMA

AL-6260 (FAA)


21224

VORTAC OKW	APP CRS	Rwy Idg	6007
111.0	076°	TDZE	700
Chan 47		Apt Elev	700

VOR RWY 5
BESSEMER (EKY)

NA Inoperative table does not apply. When local altimeter setting not received, use Alabaster altimeter setting and increase all MDAs 60 feet; increase S-5 Cat C visibility 1/8 SM and Circling Cat D visibility 1/4 SM.	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct OKW VORTAC and hold.
--	---

AWOS-3PT 118.825	BIRMINGHAM APP CON 124.9 351.85	CLNC DEL 123.75	UNICOM 123.0 (CTAF) 0
---------------------	------------------------------------	--------------------	--------------------------

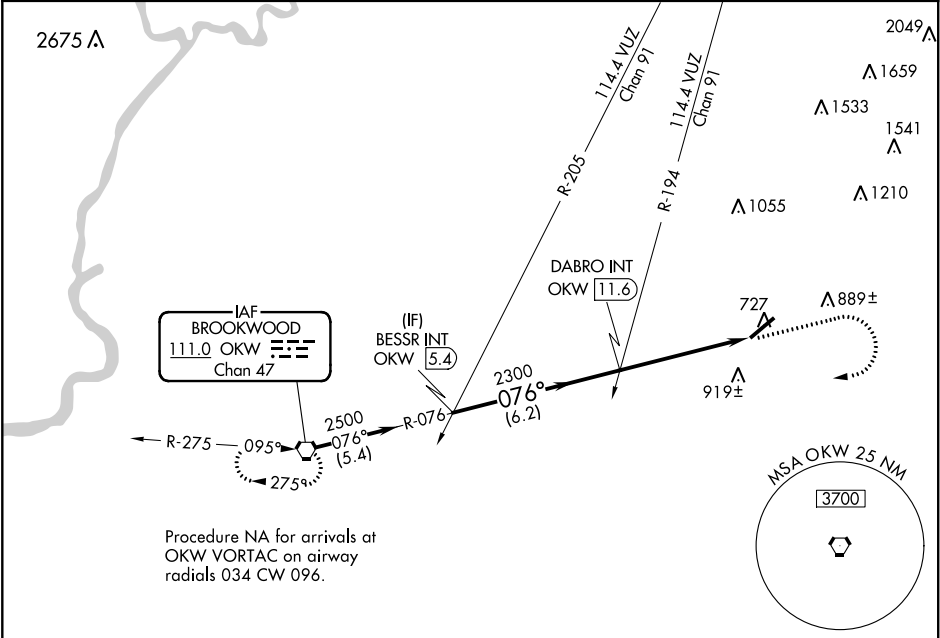

Procedure Turn NA	BESSR INT OKW 5.4		DABRO INT OKW 11.6		OKW 1500		OKW 3000		OKW		
	2500		2300		OKW 16.4						
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 60).											
		6.2 NM		4.9 NM							
		076°		3.02° TCH 45							
CATEGORY	A			B		C			D		
S-5	1180-1 480 (500-1)			1180-1 ³ / ₈ 480 (500-1 ³ / ₈)			1180-1 ¹ / ₂ 480 (500-1 ¹ / ₂)				
CIRCLING	1200-1 500 (500-1)			1220-1 ¹ / ₂ 520 (600-1 ¹ / ₂)			1320-2 620 (700-2)				