

WAAS CH 69431 W05A	APP CRS 049°	Rwy Idg TDZE 166 Apt Elev 166
--	------------------------	---


RNAV (GPS) RWY 5
MOUNT OLIVE MUNI (W40)

NA

DME/DME RNP-0.3 NA. Rwy 5 helicopter visibility reduction below $\frac{3}{4}$ SM NA. Obtain Seymour-Johnson AFB altimeter setting on CTAF; when not received, use Duplin Co altimeter setting and increase LPV DA to 634 and all MDA 20 feet.

MISSED APPROACH: Climb to 900 then climbing right turn to 2000 direct WIKOG and hold.

SEYMOUR JOHNSON APP CON ★ 119.7 273.6	UNICOM 122.8 (CTAF)
---	-------------------------------

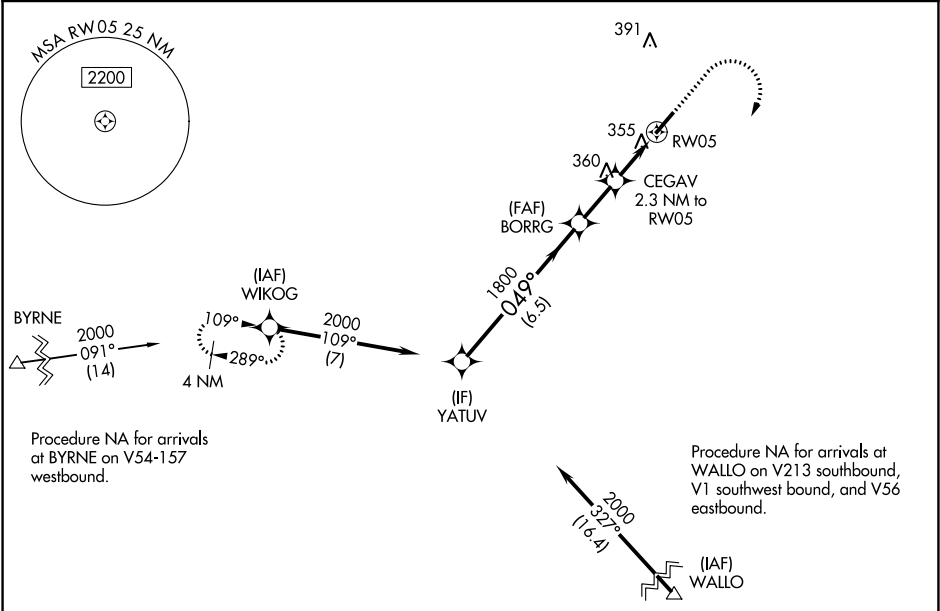

748

VGSI and RNAV glidepath not coincident (VGSI Angle 3.50/TCH 43).

YATUV 2000 049° 1800 BORRG 1800 CEGAV 2.3 NM to RW05 RW05

GP 3.45° TCH 60

6.5 NM 2 NM 2.3 NM

*1060

*LNAV only.

CATEGORY	A	B	C	D
LPV DA	625-1 $\frac{3}{8}$	459 (500-1 $\frac{3}{8}$)		NA
LNAV MDA	640-1	474 (500-1)	640-1 $\frac{3}{8}$ 474 (500-1 $\frac{3}{8}$)	NA
CIRCLING	700-1	534 (600-1)	720-1 $\frac{1}{2}$ 554 (600-1 $\frac{1}{2}$)	NA

ELEV 166 TDZE 166

5254 X75

049° to RW05

MIRL Rwy 5-23