


WAAS CH 58206 W18B	APP CRS 185°	Rwy Idg 12600 TDZE 629 Apt Elev 629
--	------------------------	--

RNAV (GPS) RWY 18R
HUNTSVILLE INTL-CARL T JONES FLD (HSV)

RNP APCH-GPS.	ALSIF-2	MISSED APPROACH: Climb to 3100 direct BOSAC and hold.
⚠ Circling NA for Cats C/D/E east of Rwy 18L-36R. Simultaneous approach authorized. LNAV procedure NA during simultaneous operations. Use of FD or AP required during simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -8 °C or above 54°C. For inop ALS, increase LPV Cat E visibility to RVR 4000, LNAV/VNAV Cat E visibility to RVR 5000, and LNAV Cat E visibility to 1¼ SM.	⚠	

ATIS 121.25	HUNTSVILLE APP CON ★ 125.6 354.1	HUNTSVILLE TOWER ★ 127.6 (CTAF) 0 350.35	GND CON 121.9 269.525	CLNC DEL 120.35	UNICOM 122.95
-----------------------	--	--	---------------------------------	---------------------------	-------------------------

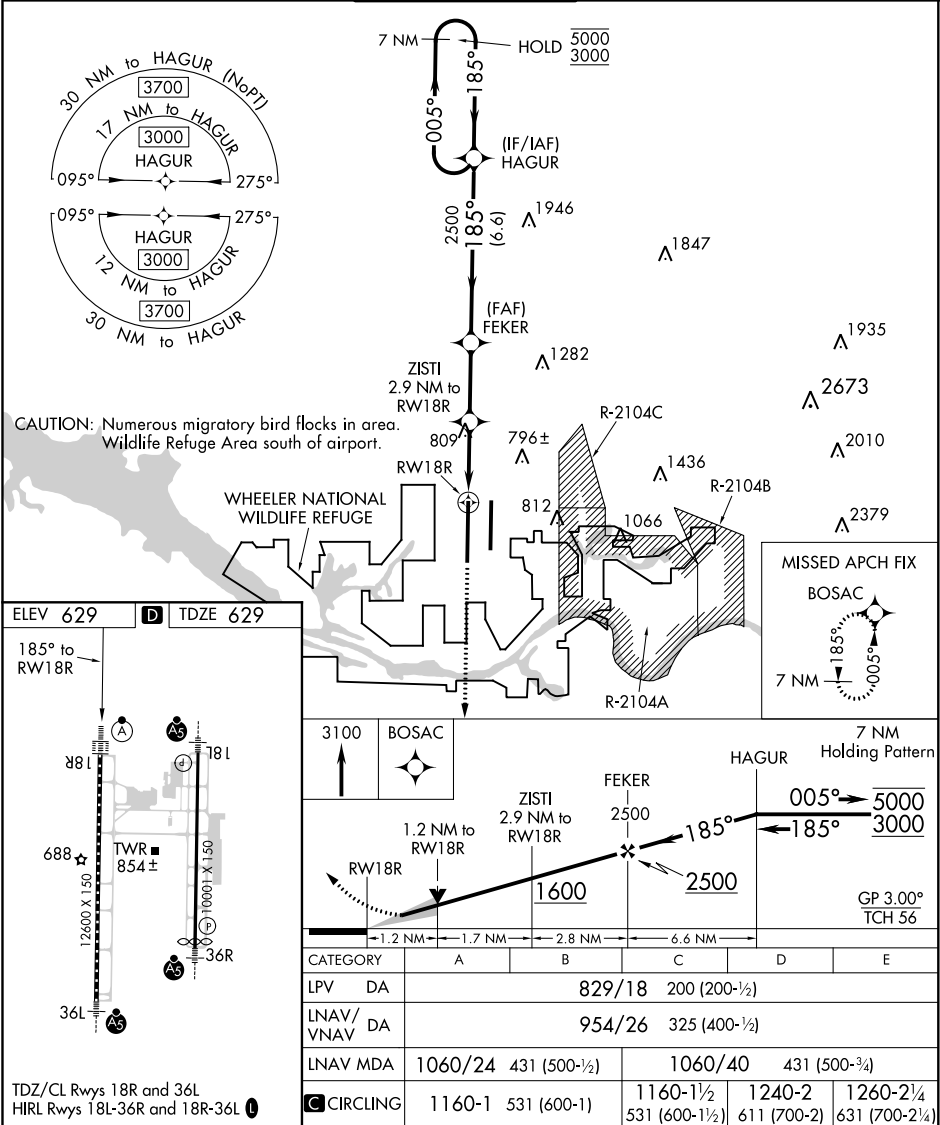

SE-4, 14 JUL 2022 to 11 AUG 2022

SE-4, 14 JUL 2022 to 11 AUG 2022