

WAAS CH 49008 W05A	APP CRS 045°	Rwy Idg TDZE Apt Elev	5502 18 18
--	------------------------	-----------------------------	---------------------------------------

RNAV (GPS) RWY 5

CURRITUCK COUNTY RGNL (ONX)


▼

▲

Baro-VNAV NA when using Oceana NAS/Apollo Soucek altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 49°C (120°F). DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. Procedure NA when tethered balloon located approximately 11.4 NM southwest of airport is flying. When local altimeter setting not received, use Oceana NAS/Apollo Soucek altimeter setting and increase all DA 59 feet, and all MDA 60 feet; increase LNAV Cat. C and D visibility ¼mile.

MISSED APPROACH:
Climb to 2000 direct HAKBI and hold.

AWOS-3 119.775	OCEANA APP CON 123.9 266.8	CTAF 122.90
--------------------------	--------------------------------------	-----------------------

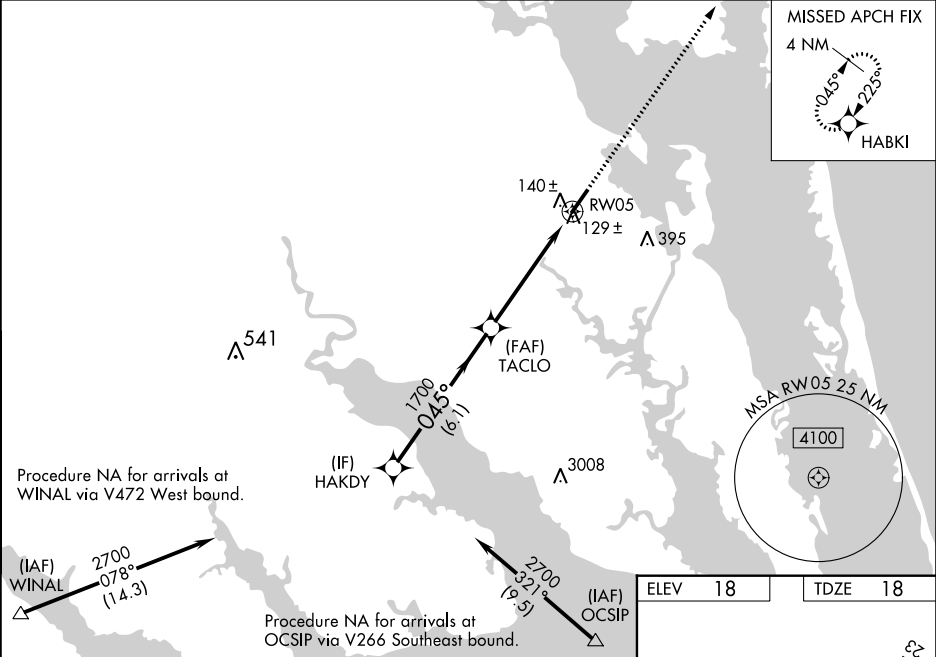

Procedure Turn NA GP 3.00° TCH 45 2700 045° 1700 6.1 NM 5.1 NM RW05				2000 ↑	HAKBI ✧
HAKDY				TACLO	
CATEGORY		A	B	C	D
LPV DA		343-1¼ 325 (400-1¼)			
LNAV/VNAV DA		410-1½ 392 (400-1½)			
LNAV MDA		400-1 382 (400-1)			400-1¼ 382 (400-1¼)
CIRCLING		440-1 422 (500-1)	480-1 462 (500-1)	480-1½ 462 (500-1½)	760-2½ 742 (800-2½)

