
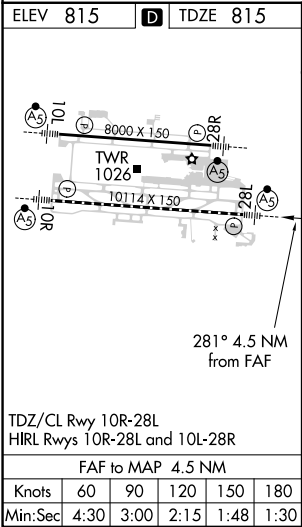


LOC/DME I-CMH 111.75 Chan 54 (Y)	APP CRS 281°	Rwy Idg 10113 TDZE 815 Apt Elev 815
--	------------------------	--

ILS or LOC RWY 28L
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required. Simultaneous approach authorized. For inop ALS, increase S-LOC 28L Cat C/D visibility to 1 3/8 SM.			MALSR	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.	
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC

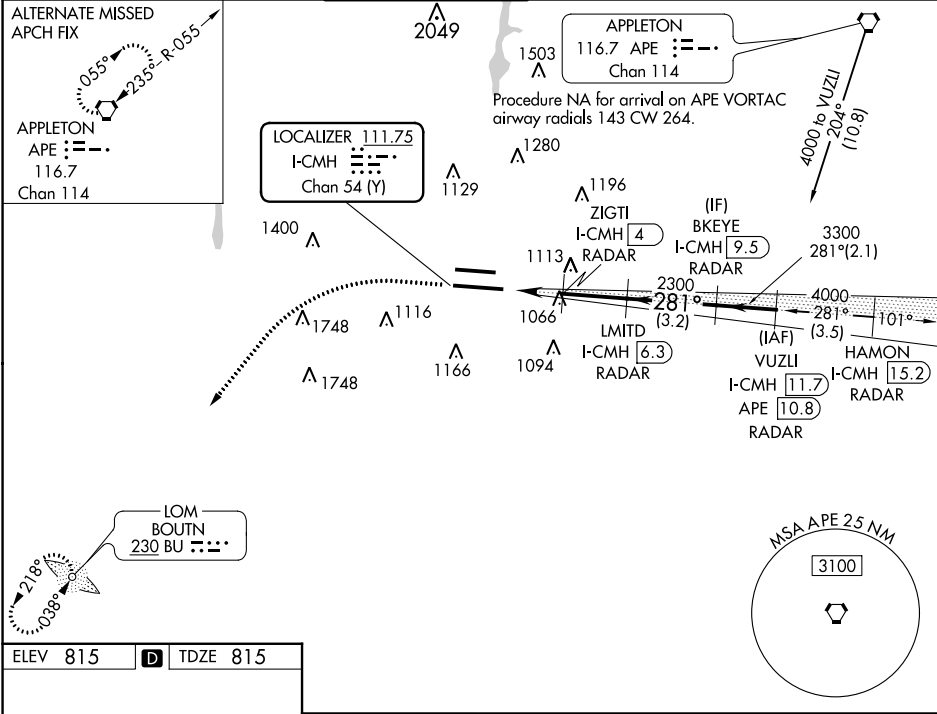

ELEV 815 TDZE 815		1400 3000 BU		VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 68).	
CATEGORY		A	B	C	D
S-ILS 28L		1015/18 200 (200-1/2)			
S-LOC 28L		1300/24 485 (500-1/2)		1300/50	485 (500-1)
CIRCLING		1340-1 525 (600-1)		1520-2 705 (800-2)	1520-2 1/4 705 (800-2 1/4)

EC-2, 26 JAN 2023 to 23 FEB 2023

EC-2, 26 JAN 2023 to 23 FEB 2023