

VORTAC MMT 113.2 Chan 79	APCH CRS 328°	Rwy Idg 9009 TDZE 243 Arpt Elev 254
--	-------------------------	--

APCH CRS
328°

Rwy Idg	9009
TDZE	243
Arpt Elev	254

AL-951 [USAF]

HI-TACAN RWY 32

MC ENTIRE JNGB (KMMT)

T * When ALS inop, increase CAT CDE RVR 60, vis to 1 1/8 miles.




† MISSED APPROACH: Climb to 1100 direct MORRL/1 DME then climbing right turn to 3100 intercept MMT R-058 direct JOGSA/12 DME and hold.

ATIS ★
327.05

SHAW APP CON
125.4 318.1

TOWER ★
132.4 (CTAF) **L** 253.5

GND CON
127.625 226.675

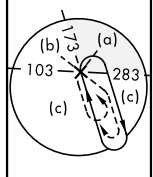

Remain within 4 NM of MMT to avoid R6001,
if unable expect 10 min delay for deactivation.

HOLD $\overline{8000}$
 $\overline{3100}$ \

† Published missed approach requires deactivation of R-6001A/B.

FLORENCE
115.2 FLO 
Chap 99

COLLIERS
113.9 IRQ
Chan 86

Florence feeder requires
ATC approval to
avoid R-6002.

CHARLESTON
13.5 CHS 
Chen 82

EMERG SAFE ALT 100 NM 3800

ELEV	254		TDZE	243
------	-----	--	------	-----

FAF to MAP 4.5 NM

Knots	120	140	160	180	200
Min:Sec	2:15	1:56	1:41	1:30	1:21

CATEGORY	C	D	E
S-32 *	640-40	397 (400-34)	
 CIRCLING	880-1 $\frac{3}{4}$ 626 (700-1 $\frac{3}{4}$)	940-2 $\frac{1}{4}$ 686 (700-2 $\frac{1}{4}$)	1020-2 $\frac{3}{4}$ 766 (800-2 $\frac{3}{4}$)

EASTOVER, SOUTH CAROLINA

Amdt 4 25MAY17

33°55'N-80°48'W

MC ENTIRE JNGB (KMMT)

HI-TACAN RWY 32