


LOC/DME I-AQI 111.75 Chan 54 (Y)	APP CRS 101°	Rwy Idg 10113 TDZE 809 Apt Elev 815
---	------------------------	--

ILS or LOC RWY 10R

JOHN GLENN COLUMBUS INTL (CMH)


ADF required. DME or RADAR required.		MALSR	MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.		
Simultaneous approach authorized.					

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
------------------------	---	--------------------------------------	-------------------------------	--------------------------	-------

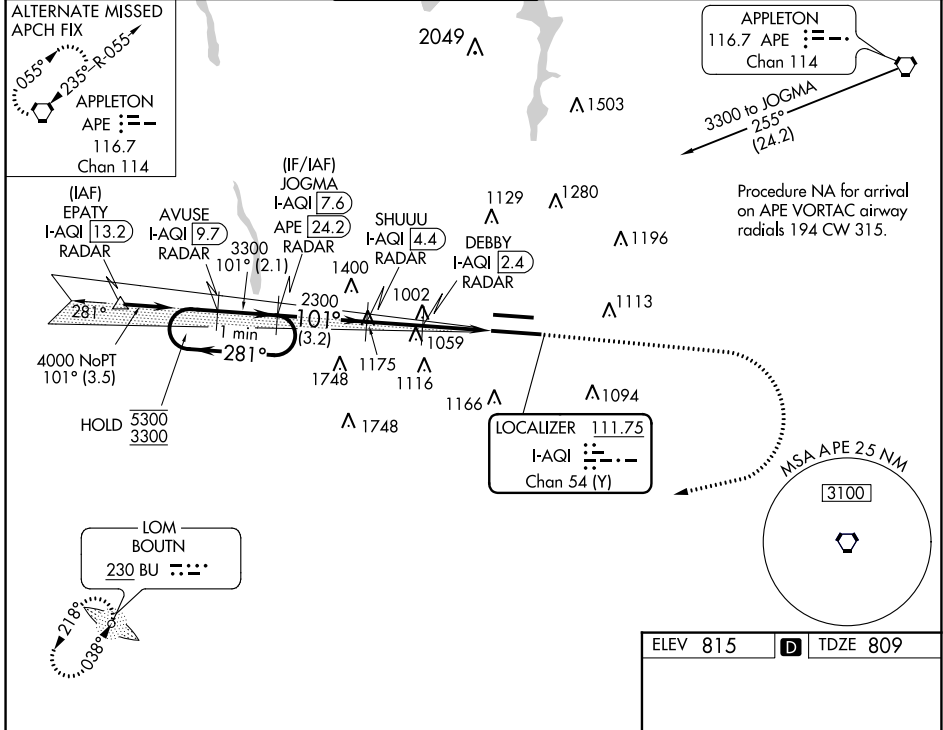


EC-2, 07 SEP 2023 to 05 OCT 2023

EC-2, 07 SEP 2023 to 05 OCT 2023

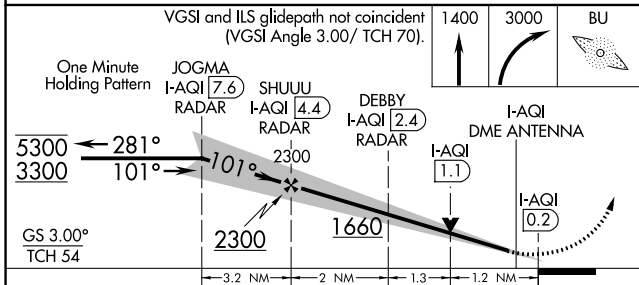

ELEV 815	D TDZE 809
----------	-------------------

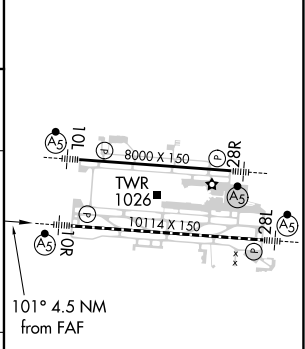

CATEGORY	A	B	C	D	TDZ/CL Rwy 10R-28L	HRL Rwys 10R-28L and 10L-28R
S-ILS 10R		1009/18	200 (200-½)			
S-LOC 10R	1260/24	451 (500-½)	1260/45	451 (500-¾)		FAF to MAP 4.5 NM
C CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 ¼ 705 (800-2 ¼)	Knots	Min:Sec
					60 90 120 150 180	4:30 3:00 2:15 1:48 1:30