


LOC/DME I-AQI 111.75 Chan 54 (Y)	APP CRS 101°	Rwy Idg 10113 TDZE 809 Apt Elev 815
--	------------------------	--

ILS or LOC RWY 10R
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.			MALSR 	MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.	
Simultaneous approach authorized.					
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC

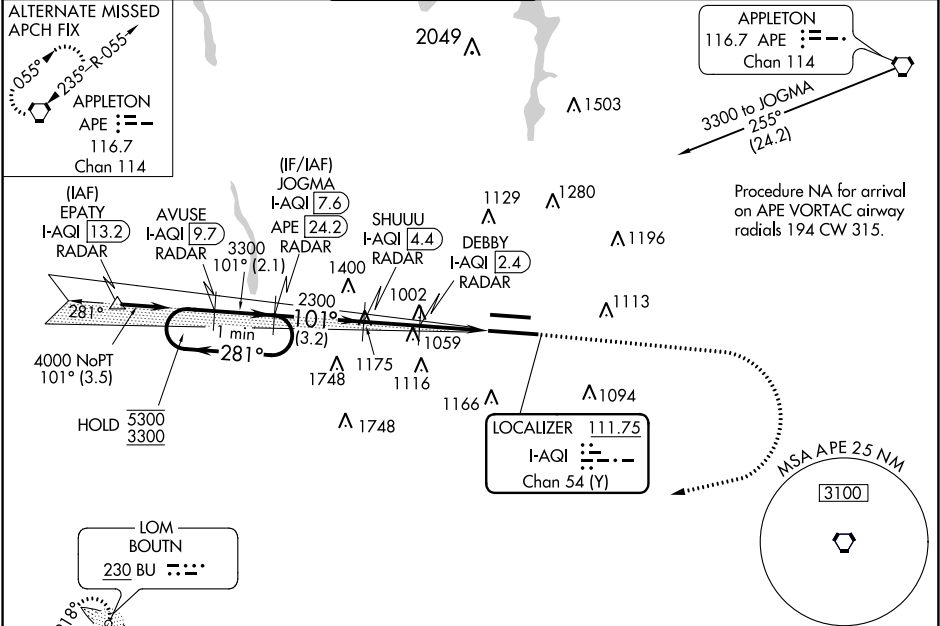

ELEV 815		D		TDZE 809	
VGSI and ILS glidepath not coincident (VGSI Angle 3.00/ TCH 70). One Minute Holding Pattern JOGMA I-AQI 7.6 RADAR SHUUU I-AQI 4.4 RADAR DEBBY I-AQI 2.4 RADAR I-AQI 1.1 I-AQI 0.2 I-AQI DME ANTENNA GS 3.00° TCH 54 1400 3000 BU 101° 4.5 NM from FAF 101° 28R 8000 X 150 TWR 1026 10114 X 150 101° 28L					
CATEGORY	A	B	C	D	
S-ILS 10R	1009/18		200 (200-½)		
S-LOC 10R	1260/24	451 (500-½)	1260/45	451 (500-¾)	
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 ¼ 705 (800-2¼)	
Knots		60	90	120	150 180
Min:Sec		4:30	3:00	2:15	1:48 1:30

EC-2, 30 NOV 2023 to 28 DEC 2023

EC-2, 30 NOV 2023 to 28 DEC 2023