

APP CRS
297°

Rwy Idg
TDZE
Apt Elev
2621
5
5

RNAV (GPS) Z RWY 30

SAN CARLOS (SQL)


▼

▲

DME/DME RNP-0.3 NA. When local altimeter setting not received, use San Francisco Intl altimeter setting and increase all MDA 40 feet. Rwy 30 visibility reduction by helicopters below 1 SM NA.

MISSED APPROACH: Climbing left turn to 5400 direct AMEBY and hold, continue climb-in-hold to 5400. Missed approach requires minimum climb of 302 feet per NM to 5400.

ATIS 125.9	NORCAL APP CON 133.95 317.6	SAN CARLOS TOWER ★ 119.0 (CTAF) 0 326.2	GND CON 121.6	UNICOM 122.95
---------------	--------------------------------	--	------------------	------------------

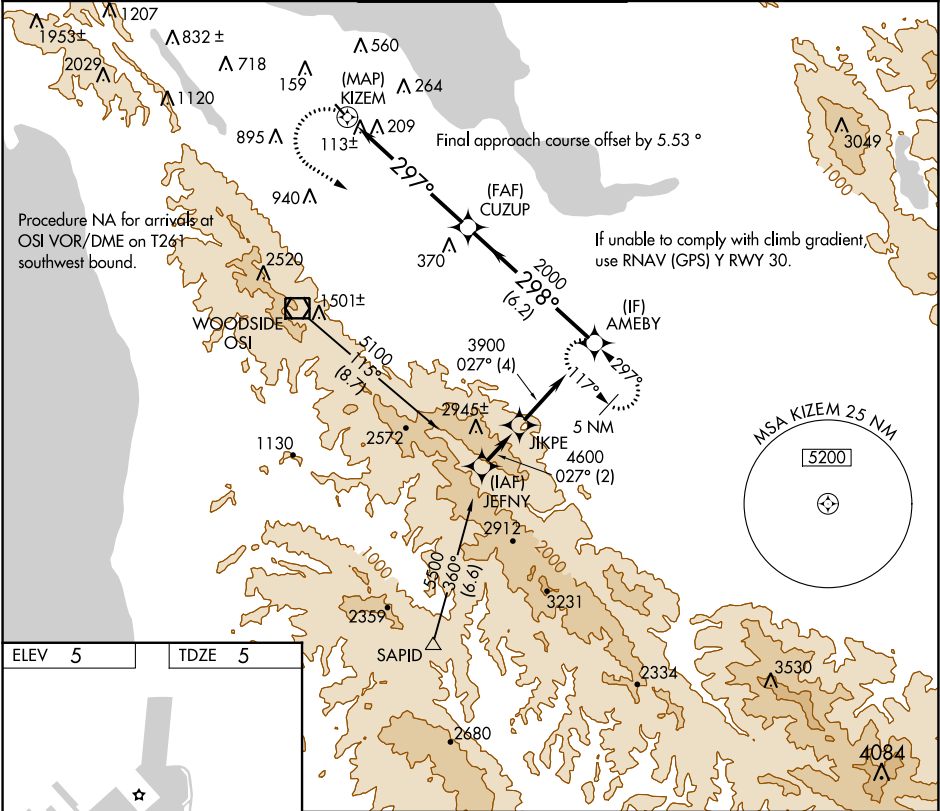

ELEV 5

TDZE 5

5400

AMEBY

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 25).

CUZUP

AMEBY

3900

298°

2000

297°

KIZEM

3.05°

TCH 40

0.1

5.9 NM

6.2 NM

CATEGORY	A	B	C	D
LNAV MDA	900-1¼ 895 (900-1¼)	900-1½ 895 (900-1½)	NA	

REIL Rwys 12 and 30 1
MIRL Rwy 12-30 1