

SUFFOLK EXEC (SFQ)(KSFQ) 3 SW UTC-5(-4DT) N36°40.97' W76°35.98'

WASHINGTON

70 B NOTAM FILE SFQ

H-101, 121, L-350, 36H

RWY 04-22: H5007X100 (ASPH) S-30, D-60, 2D-60 HIRL

RWY 04: REIL. PAPI(P4L)—GA 3.0° TCH 39'. Tree. Rgt tfc.

RWY 22: REIL. PAPI(P4L)—GA 3.5° TCH 45'. Trees.

RWY 07-25: H3750X100 (ASPH) S-30, D-50, 2D-85 MIRL

RWY 07: Tree.

RWY 25: Trees. Rgt tfc.

SERVICE: S4 FUEL 100LL, JET A, MOGAS LGT Actvt REIL Rwys 04 & 22; HIRL Rwy 04-22, MIRL Rwy 07-25—CTAF.

AIRPORT REMARKS: Attended 1300-2200Z†. Parachute Jumping. Deer on and invof arpt. Parachute activity on and invof arpt. Rwy 07 rwy end arrow heads painted white instead of designed aviation yellow. Rwy 07 markings faded and poor condition. Rwy 25 markings in poor condition.

AIRPORT MANAGER: 757-514-4411

WEATHER DATA SOURCES: AWOS-3 119.375 (757) 934-3942.

COMMUNICATIONS: CTAF/UNICOM 122.7

Ⓡ **NORFOLK APP/DEP CON** 127.9

CLEARANCE DELIVERY PHONE: For CD ctc Norfolk Apch at 757-464-0757.

RADIO AIDS TO NAVIGATION: NOTAM FILE FKN.

FRANKLIN (L) (L) VORTACW 110.6 FKN Chan 43 N36°42.85'

W77°00.74' 104° 20.0 NM to fld. 84/9W.

VOR unusable:

090°-119° byd 18 NM blo 2,000'

119°-128° byd 10 NM

129°-134° byd 33 NM

135°-148°


TACAN AZIMUTH unusable:

090°-139°

DME unusable:

090°-139°

LOC/DME 109.95 I-RKH Chan 36(Y) Rwy 04.

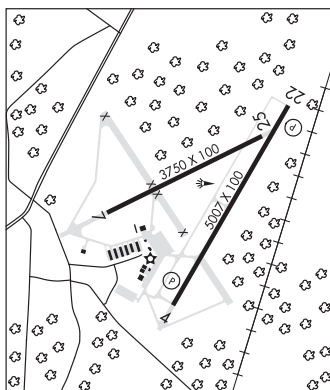

TANGIER ISLAND (TGI)(KTGI) 1 W UTC-5(-4DT) N37°49.55' W75°59.86'

WASHINGTON

5 B TPA—See Remarks NOTAM FILE DCA

L-34E, 36I

RWY 02-20: H2426X75 (ASPH) S-12.5

IAP

RWY 02: Tree. Rgt tfc.

RWY 20: Thld dsplcd 183'. Road.

SERVICE: LGT Arpt bcn OTS indef.

AIRPORT REMARKS: Attended Apr-Oct Sat-Sun 1300-2130Z†. Arpt closed SS-SR daily. Be alert: rstd area one mi west of arpt; hi-speed acft drop bombs & fire live ammunition in area. PAEW adjacent to all rwys, twys & ramps. TPA-605(600) lgt acft, 1505(1500) hvy acft. Rwy end 02: prev rwy nrs vsb on former rwy pavement. Chevrons on former rwy pavement poor. Rwy centerline poor. Rwy end 20: twy lead-in lines poor. Rwy centerline poor. Landing/parking fee to help pay for rwy rehab. Ldg fee.

AIRPORT MANAGER: 757-891-2496

WEATHER DATA SOURCES: AWOS-3 119.8 (757) 891-2246.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **PATUXENT APP/DEP CON** 121.0 (1200-0400Z† Mon-Sun. Other times by NOTAM) other times ctc

Ⓡ **POTOMAC APP/DEP CON** 127.2

CLEARANCE DELIVERY PHONE: For CD ctc Patuxent Apch at 301-342-3740, when Patuxent Apch is clsd ctc Potomac Apch at 866-640-4124.

RADIO AIDS TO NAVIGATION: NOTAM FILE DCA.

CAPE CHARLES (L) (L) VORTACW 112.2 CCV Chan 59 N37°20.85' W75°59.86' 010° 28.7 NM to fld. 10/10W.

TACAN AZIMUTH unusable:

005°-015° byd 20 NM blo 4,000'

VOR unusable:

137°-322° byd 17 NM blo 2,000'

137°-322° byd 22 NM blo 3,000'

DME unusable:

005°-015° byd 20 NM blo 4,000'

