

**SKANEATELES AERO DROME** (6B9) 2 SW UTC-5(-4DT) N42°54.84' W76°26.45'

NEW YORK

1039 TPA—1839(800) NOTAM FILE BUF

L-32F

**RWY 04-22:** 3350X130 (TURF) 0.8% up SW

IAP

**RWY 04:** Trees.

**RWY 22:** Fence.

**RWY 10-28:** H3134X58 (ASPH) S-9 MIRL(NSTD) 0.4% up W

**RWY 10:** REIL. Thld dsplcd 243'. Trees.

**RWY 28:** REIL. Trees.

**SERVICE:** FUEL 100LL LGT Arpt lgt OTS indef. ACTIVATE MIRL Rwy 10-28—CTAF.

**AIRPORT REMARKS:** Unattended, call manager. Fuel avbl 24 hr self svc credit card. Rwy 28 two 55' power poles 70' either side centerline 700' from thld. Rwy 04-22 avbl 15 May to 15 Oct. Rwy 10-28 NSTD MIRL, lghts are 38' from pavement edge. Rwy 28 has 4 lghts out and 2 lghts very dim. One thld lgt is rotated 90° (red/green lens). Rwy 10 3' fence 20' from thld on both sides, 15' road 30' from thld on both sides and 4' fence 80' from thld on both sides. -10' culvert/ditch 50' left of centerline at thld. Rwy 04-22 has variations in rwy sfc.

**AIRPORT MANAGER:** 707-580-9240

**WEATHER DATA SOURCES:** AWOS-3P 120.125 (315) 685-5790.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ SYRACUSE APP/DEP CON 126.125

**CLEARANCE DELIVERY PHONE:** For CD ctc Syracuse Apch at 315-455-6218.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE SYR.

**SYRACUSE (VH) (H) VORTACW** 117.0 SYR Chan 117 N43°09.63' W76°12.27' 226° 18.1 NM to fld. 453/11W.

TACAN AZIMUTH unusable:

Byd 35 NM blo 4,000'

VOR unusable:

010°-025°

026°-066° byd 40 NM

067°-077° byd 30 NM

078°-133° byd 40 NM

134°-144° byd 19 NM

145°-216°

217°-227° byd 40 NM blo 18,000'

228°-288° byd 40 NM

289°-299° byd 40 NM blo 2,300'

289°-299° byd 47 NM


300°-351° byd 40 NM

352°-009° byd 40 NM blo 3,000'

352°-009° byd 57 NM

DME unusable:

Byd 35 NM blo 4,000'

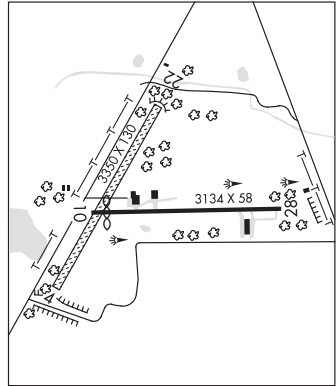

**SKY ACRES** (See MILLBROOK on page 221)

**SOUTH ALBANY** (See SOUTH BETHLEHEM on page 248)

**SOUTH BETHLEHEM**

**SOUTH ALBANY** (4B0) 2 N UTC-5(-4DT) N42°33.64' W73°50.04'

NEW YORK

196 NOTAM FILE BTV

L-32G, 33B, 34I

**RWY 01-19:** H2853X60 (ASPH) LIRL 0.4% up N

IAP

**RWY 01:** RVR-T Thld dsplcd 150'. Fence.

**RWY 19:** RVR-R Thld dsplcd 124'. Road.

**SERVICE:** S4 FUEL 100LL, JET A LGT ACTVT LIRL Rwy 01-19 and windsock lgt—CTAF.

**NOISE:** Helicopter noise abatement procedures in effect. VFR dep maintain rwy hdg until reaching 500' AGL. Avoid arr and dep to/from the west.

**AIRPORT REMARKS:** Attended Nov-Mar 1300-2100Z, Apr-Oct 1100-0200Z. Birds on and invof arpt. Arpt clsd to acft over 12,500 lbs. +17' railroad across centerline 200' S of Rwy 01.

**AIRPORT MANAGER:** (518) 281-5430

**COMMUNICATIONS:** CTAF 122.9

Ⓡ ALBANY APP/DEP CON 118.05

**CLEARANCE DELIVERY PHONE:** For CD ctc Albany Apch at 518-862-2299.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE BTV.

**CAMBRIDGE (L) (L) VORW/DME** 115.0 CAM Chan 97 N42°59.66' W73°20.64' 234° 33.8 NM to fld. 1490/14W.

DME portion unusable:

040°-130° blo 9,000'