

LOC/DME I-CMH <u>111.75</u> Chan 54 (Y)	APP CRS 281°	Rwy Idg 10113 TDZE 815 Apt Elev 815
---	------------------------	--

ILS or LOC RWY 28L
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required

T Simultaneous approach authorized.

A For inop ALS, increase S-LOC 28L Cat C/D visibility to 1 $\frac{3}{8}$ SM.





MALSR





MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
-----------------	------------------------------------	-------------------------------	------------------------	-------------------	-------

ALTERNATE MISSED
APCH FIX

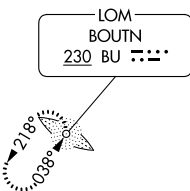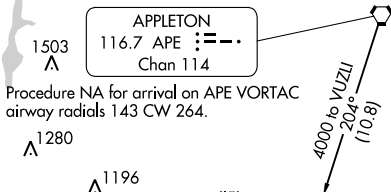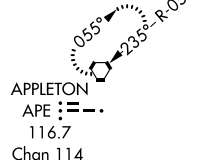

ELEV 815	D	TDZE 815
----------	----------	----------

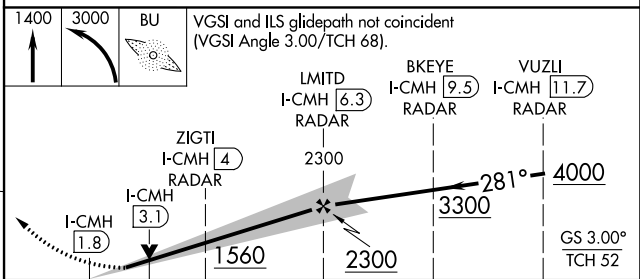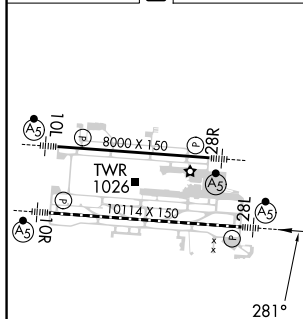

	1.3 NM	0.9 NM	2.3 NM	3.2 NM	2.1 NM	
CATEGORY	A	B	C	D		
S-ILS 28L	1015/18 200 (200-½)					
S-LOC 28L	1300/24 485 (500-½)			1300/50 485 (500-1)		
 CIRCLING	1340-1 525 (600-1)			1520-2 705 (800-2)		1520-2¼ 705 (800-2¼)