

WAAS
CH **63121**
W05A

APP CRS
045°

Rwy Idg
TDZE **135**
Apt Elev **137**

6003

RNAV (GPS) RWY 5
DUPLIN COUNTY (DPL)


RNP APCH.
For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C.

MISSED APPROACH: Climb to 2000 direct LITBY and on track 083° to TABDY and hold.

AWOS-3
120.675

SEYMOUR JOHNSON APP CON★
119.7 273.6

UNICOM
123.0 (CTAF) 0

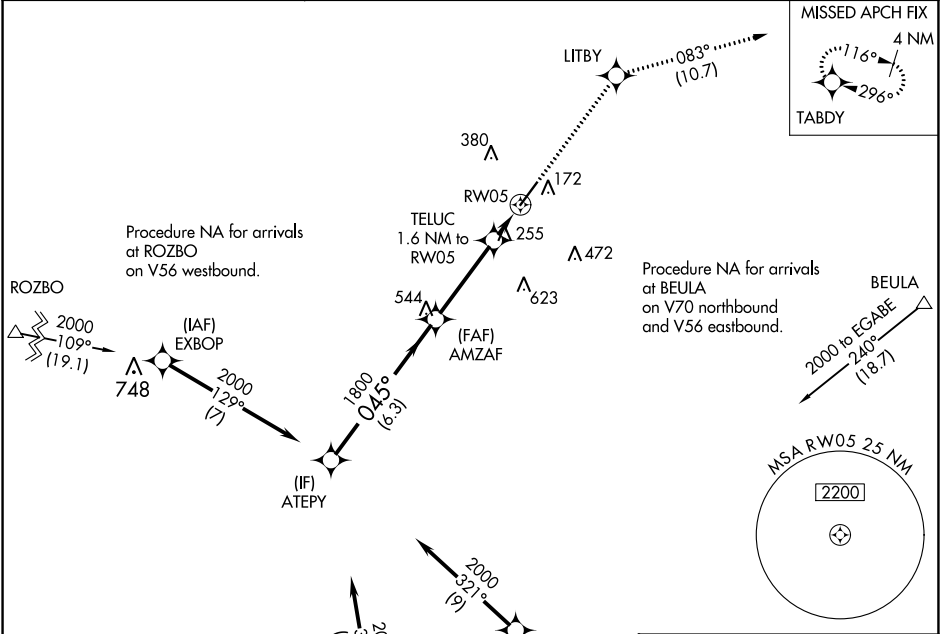

ELEV 137

TDZE 135

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 28).

ATEPY
2000
GP 3.00°
TCH 40

AMZAF
1800

LITBY
2000

tr 083°

TABDY

*LNAV only.

045°

1800

TELUC
1.6 NM to RW05

RW05

*680

6.3 NM

3.5 NM

1.6 NM

CATEGORY	A	B	C	D
LPV DA	385-¾ 250 (300-¾)			
LNAV/VNAV DA	396-⅞ 261 (300-⅞)			
LNAV MDA	520-1 385 (400-1)		520-1⅛ 385 (400-1⅛)	

045° to RW05

REIL Rwy 5 and 23 0

MIRL Rwy 5-23 0