

HAGERSTOWN RGNL/RICHARD A HENSON FLD (HGR)(KHGR) P (AR) 4 N UTC-5(-4DT)
 N39°42.51' W77°43.59'

WASHINGTON
 H-10H, 12I, L-29D, A
 IAP, AD

703 B ARFF Index—See Remarks NOTAM FILE HGR
RWY 09-27: H7000X150 (ASPH-GRVD) S-100, D-150, 2S-175,
 2D-250 PCN 62 F/B/X/T HIRL 0.3% up E
RWY 09: REIL. PAPI(P4L)—GA 3.0° TCH 55'.
RWY 27: MALSR. PAPI(P4L)—GA 3.0° TCH 55'.
RWY 02-20: H3165X100 (ASPH) S-80, D-100, 2S-127, 2D-170
 PCN 26 F/B/X/T MIRL 0.3% up N
RWY 02: REIL. PAPI(P2L)—GA 4.0° TCH 53'.
RWY 20: REIL. PAPI(P2L)—GA 4.0° TCH 33'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 02: TORA-3165 TODA-3165 ASDA-3165 LDA-3165
RWY 09: TORA-7000 TODA-7000 ASDA-7000 LDA-7000
RWY 20: TORA-3165 TODA-3165 ASDA-3165 LDA-3165
RWY 27: TORA-7000 TODA-7000 ASDA-7000 LDA-7000

SERVICE: S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT When ATCT clsd
 ACTVT MALSR Rwy 27; REIL Rwy 09; HIRL Rwy
 09-27—CTAF. **MILITARY—FUEL A, A+** (Avbl 1000-0300Z±,
 C301-791-9119, OT 3 hr PN C301-730-4700/301-730-4100,
 fee \$100/hr.) (NC-100LL) OIL 0-128

AIRPORT REMARKS: Attended 1000-0300Z±. Airport unatndd
 0300-1000Z±. Birds on and invof arpt. Ultralight act 12 NM east to 5000' MSL. Low level mil acft 10 NM north on
 VR708 operating east to west. Fuel avbl 1000-0300Z±, call 301-791-9119. DOD contract fuel avbl. Rwy 02-20
 CLOSED when ATCT clsd. Class I, ARFF Index B. ARFF Index C avbl upon req; ctc amgr. PPR 24 hrs for unsked acr ops
 with more than 30 psgr seats call amgr 240-313-2764. Rwy 02-20 clsd to sked acr ops with more than 9 pax seats
 and non sked acr ops with more than 30 pax seats excp for taxi. Twy P not avbl for air carrier ops. Ldg fee.

AIRPORT MANAGER: 240-313-2764

WEATHER DATA SOURCES: ASOS 126.375 (301) 745-3497.

COMMUNICATIONS: CTAF 120.3 UNICOM 122.95

® POTOMAC APP/DEP CON 126.825

TOWER 120.3 (1200-0300Z±) GND CON 120.8

CLEARANCE DELIVERY PHONE: For CD when ATCT is clsd ctc Potomac Apch at 866-709-4993.

AIRSPACE: CLASS D svc 1200-0300Z±; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE HGR.

(L) VORV 109.8 HGR N39°41.86' W77°51.34' 091° 6.0 NM to fld. 563/7W.

VOR unusable:

251°-280° byd 16 NM blo 4,000'

281°-300° byd 24 NM blo 8,000'


351°-050°

ST THOMAS (L) TACAN Chan 97 THS (115.0) N39°55.99' W77°57.06' 149° 17.0 NM to fld.

2338/7W. NOTAM FILE AOO.

ILS/DME 111.9 I-YUK Chan 56 Rwy 09. ILS unavbl when ATCT clsd.

ILS/DME 111.9 I-HGR Chan 56 Rwy 27. Class IE. OM/LOM OTS indef.

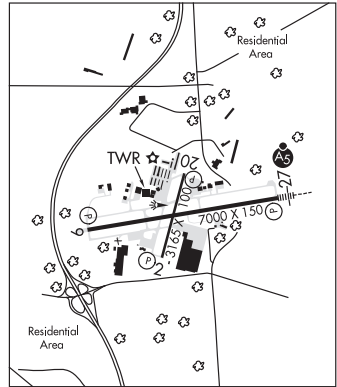

HARFORD CO (See CHURCHVILLE on page 97)

HAVRE DE GRACE SPB (M06) 1 E UTC-5(-4DT) N39°32.49' W76°04.18'

WASHINGTON

00 NOTAM FILE DCA

WATERWAY E-W: 8000X200 (WATER)

WATERWAY E: Bridge.

WATERWAY N-S: 8000X200 (WATER)

WATERWAY S: Bridge.

SEAPLANE REMARKS: Attended May-Nov dawn-dusk. Birds on and invof arpt. +100 ft bridge aprxly 3500 ft north of N/S rwy.

AIRPORT MANAGER: (410) 258-9648

COMMUNICATIONS: CTAF/UNICOM 123.0

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.