

BERLIN**PINE VALLEY** (19N) 1 SW UTC-5(-4DT) N39°46.71' W74°56.87'

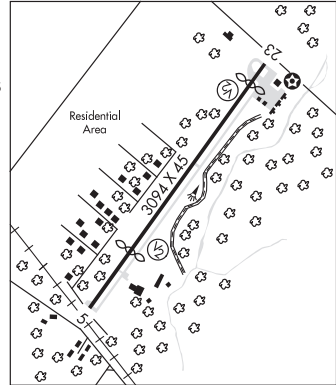
150 B NOTAM FILE MIV

RWY 05-23: H3094X45 (ASPH) MIRL 0.3% up SW**RWY 05:** REIL. PVASI(P5IR)—GA 4.0° TCH 23'. Thld dsplcd 740'.
Trees.**RWY 23:** REIL. PVASI(P5IR)—GA 4.0° TCH 40'. Thld dsplcd 239'.
Trees.**SERVICE:** S4 **FUEL** JET A **LGT** Rwy 05 VGSi OTS indef. Rwy 23 VGSi OTS indef. Actvt REIL Rwy 05-23; MIRL Rwy 05-23—CTAF. Actvt rotg bcn—CTAF.**AIRPORT REMARKS:** Attended 1400-2000Z. Unattended Christmas and New Years Day. Deer and geese on and invof arpt. Trees along NW side of Rwy 05-23. Non-standard rwy and twy lgt spacing. Twy lines and rwy hold lns very faded. Rwy 05-23 lrg longl crack in mid of rwy.**AIRPORT MANAGER:** 856-767-1233**COMMUNICATIONS:** CTAF/UNICOM 123.0Ⓡ **MC GUIRE APP/DEP CON** 126.475**CLEARANCE DELIVERY PHONE:** For CD ctc Mc Guire Apch at 609-754-2767.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MIV.**CEDAR LAKE (L) (L) VORW/DME** 115.2 VCN Chan 99 N39°32.26' W74°58.03' 014° 14.5 NM to fld. 120/10W.

WASHINGTON

L-34G, A

IAP

**BLAIRSTOWN** (1N7) 2 SW UTC-5(-4DT) N40°58.27' W74°59.85'

372 B NOTAM FILE MIV

RWY 07-25: H3112X70 (ASPH) MIRL**RWY 07:** Thld dsplcd 318'. Trees.**RWY 25:** Thld dsplcd 235'. Trees.**SERVICE:** S4 **FUEL** 100LL **OX 2** **LGT** Actvt MIRL Rwy 07-25 CTAF.**AIRPORT REMARKS:** Attended 1200-2300Z. Gliders and tow airplanes opr from turf area just south of Rwy 07-25. 24 hr self svc fuel. Hill east of arpt may require pilots execute steep apch to Rwy 25.**AIRPORT MANAGER:** 908-362-8965**COMMUNICATIONS:** CTAF/UNICOM 123.0Ⓡ **NEW YORK APP/DEP CON** 127.6 (from EAST)Ⓡ **ALLENTOWN APP/DEP CON** 124.45 (from WEST)**CLEARANCE DELIVERY PHONE:** For CD ctc Allentown Apch at 800-728-6322.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MIV.**STILLWATER (L) (L) VORW/DME** 109.6 STW Chan 33 N40°59.75' W74°52.14' 267° 6.0 NM to fld. 92Q/11W.

DME unusable:

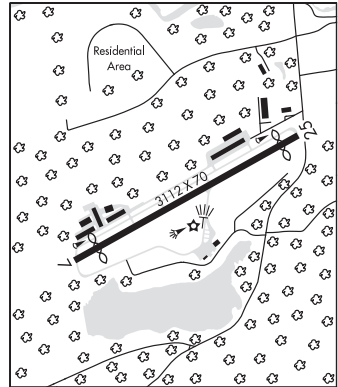
089°-099° within 12 NM blo 10,000'

210°-320° byd 30 NM blo 4,000'

NEW YORK

L-33A, 34H

IAP

**BRIDGETON****BUCKS** (ØØN) 3 NE UTC-5(-4DT) N39°28.42' W75°11.07'

108 NOTAM FILE MIV

RWY 18-36: 2420X150 (TURF) LIRL(NSTD) 0.4% up N**RWY 18:** Tree.**RWY 36:** Tree.**SERVICE:** S2 **FUEL** 100LL **LGT** Actvt LIRL Rwy 18-36—CTAF. NSTD lgt config.**AIRPORT REMARKS:** Unattended. Deer and birds on and invof arpt.**AIRPORT MANAGER:** 609-805-0408**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Washington ARTCC at 703-771-3587.

WASHINGTON