

**HARBOR SPRINGS** (MGN)(KMGD) 3 E UTC-5(-4DT) N45°25.53' W84°54.81'  
686 B NOTAM FILE MGN

LAKE HURON  
L-31B  
IAP

**RWY 10-28:** H4149X75 (ASPH) S-22, D-30 MIRL

**RWY 10:** PAPI(P4R)—GA 3.5° TCH 28'. Thld dsplcd 437'. Tree.

**RWY 28:** PAPI(P4L)—GA 4.0° TCH 35'. Thld dsplcd 444'. Pole.

**SERVICE:** FUEL 100LL, JET A+ LGT Actvt MIRL Rwy 10-28—CTAF.  
PAPI Rwy 10 and 28 opr consly. Rwy 28 PAPI unusable byd 2° left of centerline.

**NOISE:** Noise abatement procedures; no turbojet/turbofan acft depts frm 0400-1200Z±, no low flight ovr surrounding community, all acft depg to the W turn S ovr the water as soon as practical.

**AIRPORT REMARKS:** Attended 1300-dusk. Parachute Jumping. Birds and deer on and in/ov arpt. Rwy 10 apch area has two 70' lgtld obstruction poles 170' left of cntrlin; +75' trees on N side. Rwy 28 apch area has lgtld obstruction poles, 165' left and 220' right of cntrlin; 80' trees adj. Landing fee waived with minimum fuel purchase.

**AIRPORT MANAGER:** 231-206-9333

**WEATHER DATA SOURCES:** AWOS-3P 119.925 (231) 347-5231. Wind spd & drctn unrel btn 260°-280°.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

® MINNEAPOLIS CENTER APP/DEP CON 134.6

**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.


**RADIO AIDS TO NAVIGATION:** NOTAM FILE PLN.

**PELLSTON (L) (L) VORTACW** 111.8 PLN Chan 55 N45°37.84' W84°39.85' 227° 16.2 NM to fld. 836/6W.

VOR unusable:

301°-339°

GCP has azm only, no DME at GCP

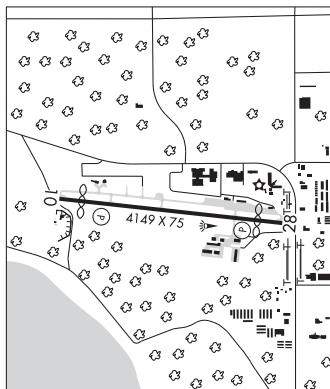

## HARRIETTA

**EAGLES LANDING** (4Y9) 3 W UTC-5(-4DT) N44°18.47' W85°46.30'  
993 NOTAM FILE LAN

GREEN BAY

**RWY 08-26:** 2200X100 (TURF) 0.8% up E

**RWY 08:** Trees.

**RWY 26:** Trees.

**AIRPORT REMARKS:** Unattended. No snow removal. Rwy 08-26 rough & uneven. Lrg depression east of Rwy 26. Rwy 08-26 mkd with 3' yellow cones. 60' trees both sides of rwy 100' from rwy cntrln.

**AIRPORT MANAGER:** 586-944-7101

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.

## HARRISON

**CLARE CO** (8ØD) 2 NW UTC-5(-4DT) N44°03.14' W84°48.79'  
1142 B NOTAM FILE LAN

LAKE HURON

**RWY 05-23:** 3000X100 (TURF)

**RWY 05:** Trees.

**RWY 23:** Thld dsplcd 800'. Road.

**RWY 18-36:** H2978X50 (ASPH) LIRL(NSTD)

**RWY 18:** Thld dsplcd 465'. Tree.

**RWY 36:** Thld dsplcd 1160'. Tree.

**RWY 09-27:** 2403X100 (TURF)

**RWY 09:** Thld dsplcd 1196'. Tree.

**RWY 27:** Thld dsplcd 837'. Tree.

**SERVICE:** LGT ACTIVATE NSTD LIRL—CTAF. Rwy 18-36 NSTD LIRL due to improper color and lctn.

**AIRPORT REMARKS:** Unattended. Deer & lrg birds on & in/ov arpt. Rwy 09-27 and Rwy 05-23 CLOSED Nov-Mar and when snow covd exc for ski equipped acft. Rwy 18-36 extsv cracking. Rwy 09-27 and dthr mkd with 3 ft yellow cones. Rwy 09-27 inmnt patches of misg turf thru full len & wid. Rwy 05-23 and dthr mkd with 3 ft yellow cones. Rwy 05 dthr 1700 ft, extds byd rwy midpt. Rwy 05-23 inmnt patches of misg turf thru full len & wid.

**AIRPORT MANAGER:** 989-862-5333

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.