

ROUND LAKE (W57) 2 E UTC-5(-4DT) N42°55.87' W73°46.25'

NEW YORK

178 NOTAM FILE BTW

RWY 14-32: 1927X76 (TURF) 1.0% up SE

RWY 14: Tree.

RWY 32: Trees.

AIRPORT REMARKS: Attended on call. Deer on and invof arpt. Arpt clsd to itinerant acft Nov-May. Rwy 14-32 has 80' trees rgt and left of centerline in primary sfc. Rwy 14-32 soft during spring (Mar-Jun). Military helicopters and ultralight acft use rwy. Access to arpt from lake overgrown. Ctc arpt mgr prior to seaplane arrival.

AIRPORT MANAGER: 518-899-6316**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Albany Apch at 518-862-2299.

• • • • •
 WATERWAY 14W-32W: 4000X600 (WATER)

ROYALTON (See GASPORT on page 207)**SANDS POINT SPB** (See PORT WASHINGTON on page 238)**SARANAC LAKE****ADIRONDACK RGNL** (SLK)(KSLK) 4 NW UTC-5(-4DT) N44°23.12' W74°12.37'

MONTREAL

1663 B LRA ARFF Index—See Remarks NOTAM FILE SLK

H-11C, 12K, L-32G

RWY 05-23: H6573X150 (ASPH-GRVD) S-40, D-73, 2S-92, 2D-115

IAP, AD

PCN 64 F/B/W/T HIRL 0.3% up NE

RWY 05: PAPI(P4L)—GA 3.0° TCH 35'. Trees.

RWY 23: MALSR. Trees.

RWY 09-27: H3997X100 (ASPH) S-40, D-73, 2S-92, 2D-115

PCN 61 F/B/W/T MIRL

RWY 09: Trees.

RWY 27: Thld dsplcd 400'. Trees.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-6573 TODA-6573 ASDA-6573 LDA-6573

RWY 09: TORA-3997 TODA-3997 ASDA-3997 LDA-3997

RWY 23: TORA-6573 TODA-6573 ASDA-6333 LDA-6333

RWY 27: TORA-3997 TODA-3997 ASDA-3997 LDA-3597

SERVICE: S4 FUEL 100LL, JET A LGT ACTIVATE HIRL Rwy 05-23,

MIRL Rwy 09-27, MALSR Rwy 23, PAPI Rwy 05 and twy

lghts—CTAF.

AIRPORT REMARKS: Attended May-Oct 1100-0200Z. Nov-Apr

1100-0100Z. For arpt attendant after hrs call 518-637-7329.

Rwy/twy/apron conds not mnt outside of nml atnd hrs. All sfc work

in prog; grass cutting Apr thru Oct. Class IV, ARFF Index A. PPR 48 hr

for unscheduled acft ops with more than 30 passenger seats call arpt manager 518-891-4600 ext 106. Index B coverage

is avbl. Twy B unavbl to acft with wingspan 79' and abv. Abv ground twy edge lghts adjacent to Twy B tie down apron

area. Rwy 09 NSTD markings, thld markings 400' from rwy end. Cold temperature airport. Altitude correction required

at or below -29C. Ldg fee.

AIRPORT MANAGER: 518-891-4600**WEATHER DATA SOURCES:** ASOS 124.175 (518) 891-6696.**COMMUNICATIONS:** CTAF/UNICOM 123.0

Ⓡ BOSTON CENTER APP/DEP CON 120.35

CLEARANCE DELIVERY PHONE: For CD if una to ctc on freq, ctc Boston ARTCC at 603-879-6859.**RADIO AIDS TO NAVIGATION:** NOTAM FILE SLK.**SARANAC LAKE (L) DME** 109.2 SLK Chan 29 N44°23.07' W74°12.27' at fld. 1647.

DME unusable:

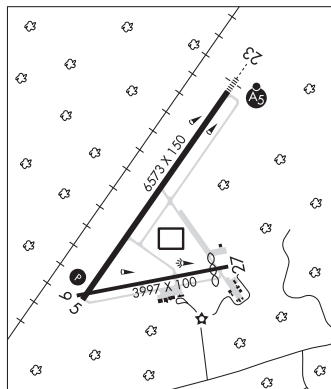
089°-104° byd 25 NM blo 10,000'

105°-110° byd 25 NM

111°-165° byd 25 NM blo 10,000'

300°-350° byd 36 NM blo 10,000'

ILS 108.9 I-SLK Rwy 23. Class IA. Unmonitored.

**SARATOGA CO** (See SARATOGA SPRINGS on page 243)